

# Shaner's Engineering & Surveying

ROAD ENGINEERING & LAND SURVEYING  
1717 S. W. McLAIN  
ROSEBURG, OREGON 97470

December 27, 1965

Mr. James Byron, Douglas County Surveyor  
Douglas County Courthouse  
Roseburg, Oregon

Dear Sir:

Following are several legal subdivision corners that we found this last fall in our road survey work for the U.S. Forest Service, Umpqua National Forest. Some of the corners we left as was, others we have re-established.

Yours truly,

*Bruce A. Shaner*  
Bruce A. Shaner  
Professional Engineer

cc: USFS, Glide, Oregon

SECTION CORNER common to SECTIONS 25, 26, 35, 36, T27S, R1W, W.M.:

Found a basalt stone from which a:

- 26" Cedar BT, scribes visible, bears N15°E (record N10°E), 25.0 feet.
- 30" Hemlock BT, scribes visible, bears S39½°E, 30.0 feet; (record 27.1 feet).
- 14" Cedar BT with old face, bears S78°W, 18.5 feet.
- 16" Fir BT, now stump with old face, bears N 12°W (record N17°W), 36.3 feet.

¼ SECTION CORNER common to Sections 36 and 31, T27S, on the Willamette Meridian:

Found a basalt stone (did not find brass cap supposedly set in 1928), from which a:

- 24" Douglas Fir BT with scribes visible bears N72½°W, 18.5 feet.
- 24" Douglas Fir BT with old face bears S88°E (record S85°E), 24.4 feet.

¼ SECTION CORNER common to Sections 30 & 31, T27S, R1E, W.M.:

Found a U.S.G.L.O. Brass cap, from which a:

- 20" Fir BT Stump (original BT), now windthrown, bears N70°E, 26.4 feet.
- 22" Fir BT Stump, original BT and now windthrown, bears S15°E, 28.4 feet.
- 40" Douglas Fir Stump, I scribed "S30 ¼ S BT" now bears N38°W, 20.0 feet.
- 26" Douglas Fir Stump, I scribed "S31 ¼ S BT" now bears S3°W, 24.1 feet.

FILED  
RECEIVED

Continued to Next Page

DEC 28 1965

COUNTY SURVEYOR  
DOUGLAS COUNTY, ORE.

COUNTY SURVEYORS FILE DATA  
DO NOT REMOVE FROM OFFICE

# Shaner's Engineering & Surveying

ROAD ENGINEERING & LAND SURVEYING  
1717 S. W. McLain  
ROSEBURG, OREGON 97470  
December 27, 1965

Letter to Douglas County Surveyor, regarding legal corners found for U.S. Forest Service,  
Continued...

**SECTION CORNER common to SECTIONS 15, 16, 21, 22, T27S, R2E, W.M.;**

Found U.S.G.L.O. Brass Cap, from which a:

- 44" Pine BT with old face bears N68°E, 53.5 feet.
- 30" Fir BT with old face bears S60½°E, 25.7 feet.
- 40" Fir BT with old face bears S61°W, 17.8 feet.
- 46" Fir BT with old face bears N60½°W, 15.8 feet.

**¼ SECTION CORNER common to SECTIONS 29 & 30, T27S, R2E, W.M.;**

Found U.S.G.L.O. Brass Cap, from which a:

- 12" Hemlock Stump, badly decayed but with scribes visible, bears S28°E, 17.8 ft..
- 26" Pine BT with old face bears S81°W, 21.1 feet.

**¼ Section Corner common to Sections 20 & 29, T27S, R2E, W.M.;**


Found U.S.G.L.O. Brass Cap, from which a:

- 24" Hemlock BT with old face bears N4°E, 30.4 feet.
- 24" Fir Stump with old face bears S55°E, 25.0 feet. (record was 27.1 feet).

**SECTION CORNER common to Sections 29, 30, 31, 32, T27S, R2E;**

Found U.S.G.L.O. Brass Cap, from which all the Bearing Trees seemed to be in order, except the one bearing N89° W, which, is the one I believe that was missing.

My notes on this corner are now missing and in possession of the U.S. Forest Service.

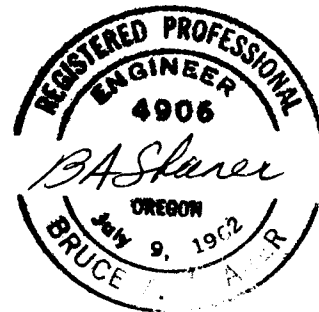

FILED  
RECEIVED

DEC 28 1965

COUNTY SURVEYOR  
DOUGLAS COUNTY, ORE.

COUNTY SURVEYORS FILE DATA  
DO NOT REMOVE FROM OFFICE