

PUBLIC LAND CORNERS


SPRINGFIELD
SURVEY FILE

WEYERHAEUSER TIMBER COMPANY
SPRINGFIELD BRANCH

TOWNSHIP 21 S RANGE 4 W

SECTION 4 CORNER SW

COUNTY Douglas OREGON

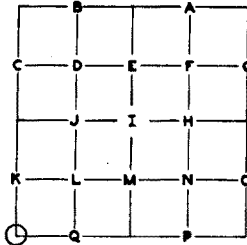

#96

GLO SURVEY RECORD

DATE: 1856

CORNER Post

PRESENT CONDITION - (DESCRIBE FULLY -
USE PAGE 2 IF NEEDED FOR EXPLANATION.)

ACCESSORIES:

	BEARING-	LINKS-	FEET-	
10" fir	N 15° E	30	19.8	Gone
12" fir	S 12° E	17	11.2	16" fir stub 12' high. Upper face open and badly burned. Scribing visible. Chopped out lower scar and fd. "BT" scribing.
7" maple	S 14° W	27	17.8	Gone
15" fir	N 73° W	28	18.5	Fd stump hole & 24" fir slid 15' down hill.

SURVEY RECORD

DATE:

PRESENT CONDITION:

CORNER SET: 10" x 10" x 18" basalt stone MAG. DECL.: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
S 12° E	11.2	GLO	16" fir stub face measurement

PAGE 1

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
10" Fir	N 27° E	32.9	-	X	X	-
3" Fir	S 29° E	9.6	-	X	X	-
6" Fir	N 6° W	21.3	-	X	X	-
10" Fir	N 74° W	16.2	-	X	X	-

IDENTIFIED ON PHOTO: No

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Maple, willow, laurel, vine maple, hazel nut

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) S 35° W ON MINUS (-) 42 %

NORTH: + 32% Logged 10-25 yr. reprod.

SOUTH: - 35% " " "

EAST: + 34% " " "

WEST: - 17% " " "

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK:

BY: Allen McChesney DATE: November 24, 1959

ENGINEER SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY: Robert Barta

COPIES SENT TO:

SEAL

PAGE 3

CS 53/104-2