


SPRINGFIELD
 SURVEY FILE

PUBLIC LAND CORNERS

MEYERHAEUSER TIMBER COMPANY
 SPRINGFIELD BRANCH
 TOWNSHIP 22S RANGE 4W
 SECTION 8 CORNER E 1/4
 COUNTY DOUGLAS OREGON

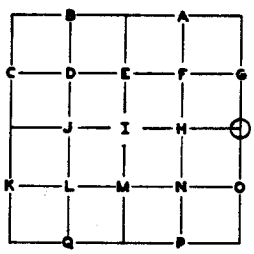

ACCESSORIES ADDED THIS DATE: _____ MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
20" FIR	N 77° E	63.7	COUNTY	X	X	
18" FIR	N 21° W	29.0	COUNTY	X	X	

IDENTIFIED ON PHOTO: _____

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: CORNER IS ON TOP OF OPEN RIDGE C - N 40° E - S 40° W
 (USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)
 SLOPE FACES (GIVE BEARING IN DEGREES) _____ ON MINUS (-) 0 %

NORTH: Level 19^d Woven Wire fence runs N 45° E. Logged to West, 60-80 year Fir to East
 SOUTH: Level 25' dirt road logged and open
 EAST: Level Logged
 WEST: Level 20' fence runs S 45° W

WORK DONE FOR W. T. CO.: _____ FIELD NOTES IN BOOK: _____

BY: Alvin M. Cheaney DATE: 6-26-59
~~ENGINEER SURVEYOR~~

UNDER THE SUPERVISION OF: _____

ASSISTED BY: _____

COPIES SENT TO: _____

GLO SURVEY RECORD

DATE: 1855
 CORNER POST

PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)

GONE

ACCESSORIES:

	BEARING-	LINKS-	FEET-	
<u>8" White Oak</u>	<u>N 40° W</u>	<u>58</u>	<u>38.3</u>	<u>FOUND OLD STUMP HOLE AND ROOTS</u>
<u>7" WHITE OAK</u>	<u>S 80° E</u>	<u>39</u>	<u>25.7</u>	<u>GONE</u>

COUNTY _____ SURVEY RECORD
 DATE: 1958

PRESENT CONDITION: _____

	BRASS CAP	F	FOUND
<u>24" Red Fir</u>	<u>N 77° E</u>	<u>65.1</u>	<u>20" Fir - SCRIBING VISIBLE - 2 FACES</u>
<u>24" Red Fir</u>	<u>N 19° W</u>	<u>30.2</u>	<u>18" Fir - SCRIBING VISIBLE - 2 FACES</u>

CORNER SET: BRASS CAP SET BY DOUGLAS COUNTY MAG. DECL.: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
<u>N 40° W</u>	<u>38.3</u>	<u>GLO</u>	
<u>N 77° E</u>	<u>65.1</u>	<u>COUNTY</u>	<u>TO CENTER OF TREE</u>
<u>N 21° W</u>	<u>30.2</u>	<u>COUNTY</u>	<u>TO CENTER OF TREE</u>

CS 53/105-3