


PUBLIC LAND CORNERS

SPRINGFIELD
SURVEY FILE

WEYERHAEUSER TIMBER COMPANY
 SPRINGFIELD BRANCH

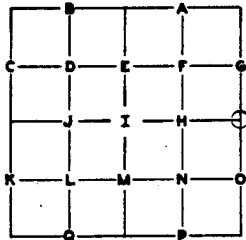

TOWNSHIP 22 S RANGE 4 W
 SECTION 10 CORNER E 1/4
 COUNTY Douglas OREGON

GLO SURVEY RECORD

PRESENT CONDITION - (DESCRIBE FULLY -
 USE PAGE 2 IF NEEDED FOR EXPLANATION.)

DATE: 1884
 CORNER Stone marked "1/4" West face

Found stone as described in GLO field notes

ACCESSORIES:

	BEARING-	LINKS-	FEET-	
40" Fir	S 10° W	3	2	46" Fir bark scribing visible both upper and lower face
14" Fir	N 80° E	5	3.3	Hollow spot - possible root hole

SURVEY RECORD
 DATE: _____

PRESENT CONDITION: _____

CORNER SET: STONE AS FOUND MAG. DECL.: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
S 7° W	5.8	GLO	46" Fir bark scribed

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
34" Fir stump	N 77° W	20.7		X	X	
38" Incense Cedar	N 25° E	22.8		x	x	

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Oregon Grape
 (USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)
 SLOPE FACES (GIVE BEARING IN DEGREES) S 70° W ON MINUS (-) 30 %

NORTH: -5% Old growth to East and West
 SOUTH: Level 10' -25% 50', then level, logged to West, old growth to East
 EAST: + 30% Old growth to North and South
 WEST: - 35% 140' Cr. C-SW OG to North, logged to South

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK: _____

BY: Glen McChesney DATE: May 29, 1958
 ENGINEER - SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY: _____

COPIES SENT TO: _____

CS 53/105-4