


PUBLIC LAND CORNERS

WEYERHAEUSER COMPANY
SPRINGFIELD BRANCH

TOWNSHIP 22 S RANGE 4 W
SECTION 21 CORNER N 1/4
COUNTY Douglas OREGON

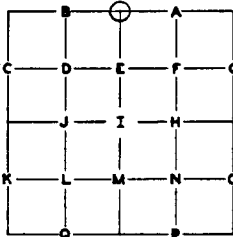

ACCESSORIES ADDED THIS DATE: _____ MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
<u>38"</u> Fir Stump	<u>N 13° E</u>	<u>10.6</u>	<u>X</u>	<u>X</u>	<u>X</u>	<u>--</u>
<u>42"</u> Fir	<u>S 11° W</u>	<u>36.7</u>	<u>X</u>	<u>X</u>	<u>X</u>	<u>--</u>

IDENTIFIED ON PHOTO: _____

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Fern, Vine maple, hazelnut
(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)
SLOPE FACES (GIVE BEARING IN DEGREES) South ON MINUS (-) 46 %

Corner is on North side of dirt road.

NORTH: + 45% logged

SOUTH: - 20% 90' creek 2' wide course west virgin timber

EAST: + 2% logged on North side and virgin timber on south side

WEST: - 2% logged on North side and virgin timber on south side

WORK DONE FOR W. CO. _____ FIELD NOTES IN BOOK: _____

BY: Robert Baiter DATE: Sept. 19, 1962
~~ENGINEER - SURVEYOR~~

ASSISTED BY: Frank Snell (BLM)
Dick Traylor (BLM)

COPIES SENT TO: _____

UNDER THE SUPERVISION OF: _____

SEAL PAGE 3

GLO SURVEY RECORD

DATE: 1855

CORNER Post

ACCESSORIES:

	BEARING-	LINKS-	FEET-
<u>18"</u> Fir	<u>N 15 E</u>	<u>18</u>	<u>11.9</u>
<u>20"</u> Fir	<u>S 10 W</u>	<u>59</u>	<u>38.9</u>

PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)

Gone - Found "I" iron stake set by Haines

38" Fir stump - Upper face chopped out and scribing visible.
42" Fir - bark scribing visible

SURVEY RECORD

DATE: _____

PRESENT CONDITION:

CORNER ~~KEY~~: Haines "I" iron MAG. DECL.: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY -	
<u>N 13° E</u>	<u>12.0</u>	<u>GLO</u>	<u>38" Fir stump - face measurement</u>
<u>S 11° W</u>	<u>37.7</u>	<u>GLO</u>	<u>42" Fir " "</u>

CS 53/105-20