


PUBLIC LAND CORNERS

SPRINGFIELD SURVEY FILE

WEYERHAEUSER TIMBER COMPANY
SPRINGFIELD BRANCH

TOWNSHIP 22S RANGE 5W
SECTION 13 CORNER N $\frac{1}{2}$
COUNTY Douglas OREGON

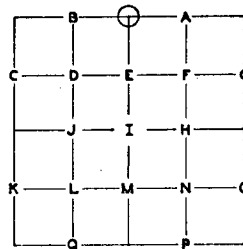

GLO SURVEY RECORD

DATE: 1855
CORNER Post

ACCESSORIES:

BEARING-	LINKS-	FEET-	
40" Fir N 7° E	109	71.9	Fd 52" Fir upper scar open. Scribing visible.
8" Fir S 76° W	110	72.6	Fd 20" stub upper scar open. Scribing visible.

SURVEY RECORD
DATE:

PRESENT CONDITION - (DESCRIBE FULLY -
USE PAGE 2 IF NEEDED FOR EXPLANATION.)

Cone

PRESENT CONDITION:

CORNER SET: 1" x 30" Aluminum Pipe MAG. DECL.: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
N 5° E	71.9	GLO	52" Fir Face measurement
S 77° W	72.6	GLO	20" Fir stub Face measurement

PAGE 1

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
52" Fir	N 05° E	70.9	X	X	X	-
24" Fir	S 88° E	7.1	-	X	X	-

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Fern, Oceanspray & Hazelnut

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) East ON MINUS (-) 38 %

NORTH: Level, logged on West side and virgin on East side.

SOUTH: - 10% logged

EAST: - 33% logged on South side and virgin on North side

WEST: + 30% logged

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK:

BY: Robert B. Boster DATE: April 22, 1960

ENGINEER & SURVEYOR
Instrumentman

ASSISTED BY:

UNDER THE SUPERVISION OF:

COPIES SENT TO:

SEAL PAGE 3

CS 53/105-A5