


SPRINGFIELD
 SURVEY FILE

PUBLIC LAND CORNERS

WEYERHAEUSER COMPANY
 SPRINGFIELD BRANCH

TOWNSHIP 23 S RANGE 3 W
 SECTION 27 CORNER SE
 COUNTY Douglas OREGON

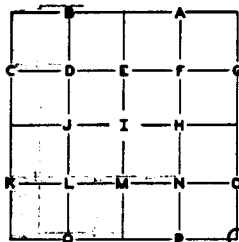

#39345

MAGNETIC DECLINATION 20-E

ACCESSORIES ADDED THIS DATE:

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
24" cedar stump	S 5 W	16.0	---	X	X	---
48" cedar (shell) stump	N 3 W	4.7	X	X	X	---
46" cedar (shell) stump	S 63 W	3.4	X	X	X	---
26" cedar stump	N 72 W	28.1	---	X	X	---

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Flat swampy ground with grasses, rushes, sword fern, and briar.

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT # 77)

SLOPE FACES (GIVE BEARING IN DEGREES) S 5 E ON TINNUS (-) 30 %

NORTH: 16% for 100'

SOUTH: -30% for 100'

EAST: -2% for 110'

WEST: -3% for 150'

FROM CORNER 1

GLO SURVEY RECORD

DATE: 1882

CORNER

PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)

Corner burned through by slash fire 1959
 Found "w" nails in 3 reference stumps

ACCESSORIES:

	BEARING-	LINKS-	FEET-	
8" cedar	S 60 E	30		Stump pushed over by cat, no evidence of scribe
33" cedar	S 85 W	6		Burned out stump (shell) "w" nail remained
36" cedar	N 40 W	4		Burned out stump (shell) no "w" nail
6" maple	N 20 E	54		No evidence of maple

SURVEY RECORD

DATE:

PRESENT CONDITION:

CORNER SET: 3/4" by 3/8" galvanized conduit MAG. DECL.: 20-E

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
<u>N 3 W</u>	<u>4.7</u>	<u>G.L.O.</u>	<u>48" cedar stump (shell) original B.T.</u>
<u>S 63 W</u>	<u>3.4</u>	<u>G.L.O.</u>	<u>46" cedar stump (shell) original B.T.</u>

WORK DONE FOR W. CO.

FIELD NOTES IN BOOK:

BY: Bob Duncan DATE: Nov. 20, 1961
 ENGINEER - SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY:

COPIES SENT TO:

SEAL PAGE 3

PAGE 1

CS 53/107-1