

# PUBLIC LAND CORNERS

SPRINGFIELD SURVEY FILE


WEYERHAEUSER TIMBER COMPANY

SPRINGFIELD BRANCH

TOWNSHIP 23 S RANGE 3 W

SECTION 28 CORNER SE

COUNTY DOUGLAS OREGON

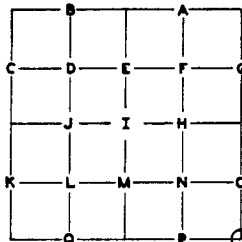

## GLO SURVEY RECORD

DATE: 1882  
CORNER POST

PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)

GONE

### ACCESSORIES:

CRUISER MARK

	BEARING-	LINKS-	FEET-	
48" Fir	N 60° E	60		Gone
6" Maple	S 25° E	45		Gone
8" Fir	S 45° W	18		Gone
36" Fir	N 14° W	62		Gone

G.A. Gardner SURVEY RECORD  
DATE: 1953

PRESENT CONDITION: Found:  
1 1/2" I.P. for Corner adscribed new post

<u>2" x 48" I.P.</u>				
<u>46" D. Fir</u>	<u>S 39° E</u>	<u>16.0'</u>	<u>S34 RS BT</u>	<u>50" Fir stump partial scribe remains</u>
<u>6" D. Fir</u>	<u>N 43 1/2° E</u>	<u>31.0'</u>	<u>S 27 RS BT</u>	<u>7" Fir S 27 RS BT</u>
<u>6" Hem</u>	<u>N 48° W</u>	<u>8.0'</u>	<u>S 28 RS BT</u>	<u>7" Hemlock S 28 RS BT</u>
<u>6" D. Fir</u>	<u>S 45 1/2° W</u>	<u>27.5'</u>	<u>S 33 RS BT</u>	<u>8" Fir S 33 RS BT</u>

CORNER SET: \_\_\_\_\_ MAG. DECL.: \_\_\_\_\_

### BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
<u>S 38° E</u>	<u>16.0</u>	<u>Gardner</u>	<u>50" Fir Stump</u>
<u>N 43° E</u>	<u>31.0</u>	<u>Gardner</u>	<u>7" Fir</u>
<u>N 47° W</u>	<u>8.1</u>	<u>Gardner</u>	<u>7" Hemlock</u>
<u>S 47° W</u>	<u>27.0</u>	<u>Gardner</u>	<u>8" Fir</u>

PAGE 1

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
<u>50" fir stump</u>	<u>S 38° E</u>	<u>16.0</u>		<u>x</u>	<u>x</u>	
<u>8" Fir</u>	<u>S 47° W</u>	<u>27.0</u>		<u>x</u>	<u>x</u>	
<u>5" fir</u>	<u>N 63° W</u>	<u>7.3</u>		<u>x</u>	<u>x</u>	
<u>9" Hemlock</u>	<u>N 56° E</u>	<u>46.1</u>		<u>x</u>	<u>x</u>	

IDENTIFIED ON PHOTO:

### INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER logged, sapling fir and hemlock, salal, v. maple, ferns

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) N 85° E ON MINUS (-) 22 %

NORTH: - 19% for 70'

SOUTH: Level 50' thence begin descend

EAST: - 21% (630 feet to WAW road #900)

583' East to fir stump with plate on upper bank of road

WEST: + 23% for 200'

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK: \_\_\_\_\_

BY: M. D. HALE DATE: MARCH 27, 1959  
ENGINEER - SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY: H. E. CASE

W. W. DIXON

COPIES SENT TO: \_\_\_\_\_

SEAL

PAGE 3

CS 53/107-b

96