

PUBLIC LAND CORNERS


SPRINGFIELD
SURVEY FILE

WEYERHAEUSER TIMBER COMPANY
SPRINGFIELD BRANCH

TOWNSHIP 23 S RANGE 3 W

SECTION 28 CORNER @ W 1/4

COUNTY DOUGLAS-LANE CTY LINE OREGON

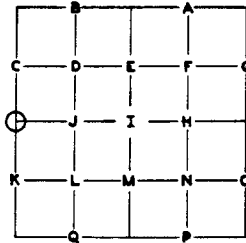

48

GLO SURVEY RECORD

DATE: 1882
CORNER POST

PRESENT CONDITION - (DESCRIBE FULLY -
USE PAGE 2 IF NEEDED FOR EXPLANATION.)

GONE

ACCESSORIES:

	BEARING-	LINKS-	FEET-	
24" Hem	S 40° W	50	33.0	Found partial face, scribing gone mostly destroyed during logging.
24" Fir	N 10° E	75		Gone

Private SURVEY RECORD
DATE:

PRESENT CONDITION:
BLM tag on 54" x 30' Fir snag N 10° E 60'
slope to corner

CORNER SET: 1/2" x 34" SIP

MAG. DECL.: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
S 40° W	33.0	GLO	34 Hem. Stump

PAGE 1

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
39" Hemlock stump	S 70° E	65.5		x	x	
30" Cedar stump	N 75° W	43.6		x	x	

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Logged, fern, wild gooseberry

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) N 60° E ON MINUS (-) 67 %

NORTH: - 28% for 40' thence steeper

SOUTH: + 36% for 40' thence steeper

EAST: - 46% for 40'

WEST: + 57% for 180'

FROM CORNER -

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK: _____

BY: M. D. HALE DATE: MARCH 31, 1959
ENGINEER - SURVEYOR

ASSISTED BY: H. E. CASE
W. W. DIXON

COPIES SENT TO:

UNDER THE SUPERVISION OF:

SEAL PAGE 3

CS 53/107-7

13