

# PUBLIC LAND CORNERS


SPRINGFIELD  
 SURVEY FILE

WEYERHAEUSER TIMBER COMPANY  
 SPRINGFIELD BRANCH

TOWNSHIP 23 S RANGE 3 W

SECTION 31 CORNER E 1/4

COUNTY DOUGLAS OREGON

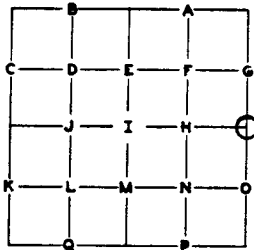

ACCESSORIES ADDED THIS DATE: 7-29-59

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
60" Fir Stump	East	6.7	x	8/14/57	x	
48" Fir Stump	S 10° W	19.5	x	8/14/57	x	

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

Salal and 1959 logging debris

GROUND COVER:

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) East ON MINUS (-) 62 %

FROM CORNER -

NORTH: + 2% 1959 Logging

SOUTH: - 3% 1959 Logging

EAST: - 62% 1959 Logging

WEST: + 50% Plate on West side of rd 200' East to 1/4 cor. 180' rock logging rd road.

GLO SURVEY RECORD				PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)
CORNER	DATE:	POST	POST	
	1882			Gone
ACCESSORIES:				
	BEARING-	LINKS-	FEET-	
50" Fir	East	10	6.6	60" Fir stump-No Scribing visible Tree was cut below scribing
36" Fir	S 10° W	43	28.4	48" Fir Stump - Scribing "BT" visible. This scribing does not appear to be the original
WTCO SURVEY RECORD				PRESENT CONDITION:
	DATE:	POST	POST	7-29-59
Pipe	8-14-57			Covered with Logging debris
60" Fir East 6.7'				Now 60" stump - Plate gone "W" nail OK
48" Fir S 10°W 19.5'				No 2 48" stump - Plate gone W nail OK

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK:

BY: ROBERT BARTA DATE: JULY 29, 1959  
 ENGINEER-SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY:

COPIES SENT TO:

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY -	
East	6.6	GLO	60" Fir Stump
S 10° W	19.5	GLO	48" Fir Stump

PAGE 1

SEAL PAGE 3

CS 53/107-8

81