


# PUBLIC LAND CORNERS

SPRINGFIELD  
 SURVEY FILE

WEYERHAEUSER COMPANY  
 SPRINGFIELD BRANCH

TOWNSHIP 23 S RANGE 4 W  
 SECTION 12 CORNER N ½  
 COUNTY Douglas OREGON

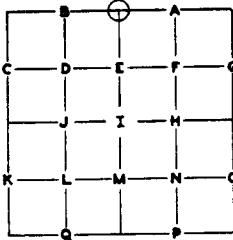

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20"

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
10" Fir	S 21 W	34.0	---	X	X	---

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Hazel, Sialal, and old logging burn.  
 (USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)  
 SLOPE FACES (GIVE BEARING IN DEGREES) S 35 E ON MINUS (-) 35 %

FROM CORNER | NORTH: + 35%  
 SOUTH: - 35%  
 EAST: - 25%  
 WEST: + 25%

WORK DONE FOR W. CO.

FIELD NOTES IN BOOK:

BY: Eden McCreaney DATE: July 30, 1963  
ENGINEER - SURVEYOR  
 Land Agent

UNDER THE SUPERVISION OF:

ASSISTED BY:

COPIES SENT TO:

SEAL PAGE 3

GLO SURVEY RECORD

PRESENT CONDITION - (DESCRIBE FULLY -  
 USE PAGE 2 IF NEEDED FOR EXPLANATION.)

DATE: 1885  
 CORNER Post

No trace

ACCESSORIES:

	BEARING-	LINKS-	FEET-	
40" Fir	N 28 E	43	28.4	48" down Fir moved out of place by old logging. Axe marks only.
50" Fir	S 8 E	64	42.2	50" Fir - has been down for several years. Burned - no scribing visible - old axe marks

SURVEY RECORD  
 DATE:

PRESENT CONDITION:

Found in field:

A "T" iron at point for corner at record distance and bearing from SE BT  
 See page 2

CORNER SET: T Iron as set by original survey MAG. DECL.: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY -	
N 28 E	49.0	GLO	Log has been moved by old logging
S 8 E	42.2	"	To stump hole position of BT if standing.

PAGE 1

CS 53/108-1