


SPRINGFIELD SURVEY FILE

PUBLIC LAND CORNERS

WEYERHAEUSER COMPANY  
SPRINGFIELD BRANCH

TOWNSHIP 23 S RANGE 4 W  
SECTION 24 CORNER S 1/2  
COUNTY Douglas OREGON

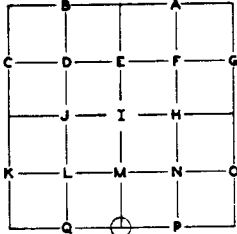

*10A*

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
70" Fir	N 54° W	23.0	--	X	X	--
8" Hemlock	S 7° W	24.9	--	X	X	--

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Salal  
(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)  
SLOPE FACES (GIVE BEARING IN DEGREES) South ON MINUS (-) 5 %

FROM CORNER ↓  
NORTH: Level  
SOUTH: - 5%  
EAST: - 3%  
WEST: Level

WORK DONE FOR W. CO.

FIELD NOTES IN BOOK:

BY: Glen McKinney DATE: August 7, 1963  
ENGINEER-SURVEYOR  
LAND AGENT

UNDER THE SUPERVISION OF:

ASSISTED BY:

COPIES SENT TO:

SEAL PAGE 3

GLO SURVEY RECORD				PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)	
DATE: <u>1884</u>				Gone	
CORNER <u>Stone</u>					
ACCESSORIES:					
BEARING-	LINKS-	FEET-			
36" Fir	N 28° E	33	21.8	Down - badly splintered 40" Fir	
40" Fir	S 12° E	18	12.9	Down - long butt moved by logging	
Weyerhaeuser Company SURVEY RECORD					
DATE: <u>1944</u>				PRESENT CONDITION: <u>August 7, 1963</u>	
Identified both original B.Ts.					
Reference post with plates:					
40" Fir N 28° E 21.8'			orig. BI		
70" Fir N 53° W 23.8'			Found plate on down Fir - Superseded		
			Found plate on 70" Fir "		

CORNER SET: Found Wilford Haines "T" iron in MAG. DECL.: 20°  
proper corner position

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
N 28° E	21.8	Orig.	
S 12° E	12.9	"	To root hole
N 28° E	21.8	WCo. -1944	To plate on down Fir
N 53° W	23.8	"	"

PAGE 1

CS 53/108-8

7EE 1944 NOTES ATTACHED