


# PUBLIC LAND CORNERS

WEYERHAEUSER COMPANY  
SPRINGFIELD BRANCH

TOWNSHIP 23 S RANGE 4 W  
SECTION 25 CORNER W 1/4  
COUNTY Douglas OREGON

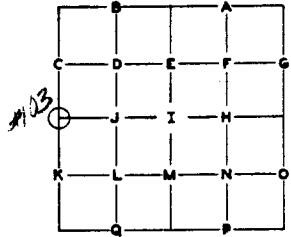

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
16" Cedar	S 57° E	22.7	---	X	X	---
16" Fir	N 60° W	56.4	---	X	X	---

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: 2nd Growth  
 (USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)  
 SLOPE FACES (GIVE BEARING IN DEGREES) N 55° W ON MINUS (-) 25 %

NORTH: + 10% for 50', thence descend, fir reproduction in old burn.  
 SOUTH: + 35% along small creek flowing North; 2nd growth fir.  
 EAST: + 50%; To South 2nd growth fir; to North fern and fir reproduction.  
 WEST: Descend and 10' to same above creek bearing N 55° W, thence + 20% to 2nd growth fir

WORK DONE FOR W. CO.

FIELD NOTES IN BOOK:

BY: William R. Tilt DATE: October 8, 1963  
 ENGINEER - SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY:

COPIES SENT TO:

SEAL PAGE 3

### GLO SURVEY RECORD

DATE: 1884  
 CORNER Stone

PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)

Found stone in place

### ACCESSORIES:

	BEARING-	LINKS-	FEET-	
50" Fir	N 37° E	12	7.9	High stump; face deeply burned out
12" Yew	S 37° W	15	9.9	Burned stump; portions of original scribing legible

### (No record) SURVEY RECORD

DATE: Unknown  
 Wilford Haines, Ore. Surveyor No. 239  
renewal as found in field

PRESENT CONDITION:

"T" iron stake at corner Good condition along side of above stone.  
16" Cedar BT Scribed face still open  
16" Fir BT " " healed over

CORNER SET: (Found stone and "T" iron stake) MAG. DECL.: 20°

### BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY -	
N 45° E	11.0	1884	To center of stump.
N 35° W	10.2	1884	" " " "
S 57° E	22.7	Haines	To scribed face
N 60° W	56.4	"	" " " "

CS 53/108-11