


PUBLIC LAND CORNERS

WEYERHAEUSER COMPANY
SPRINGFIELD BRANCH

TOWNSHIP 24S RANGE 2W
SECTION 15 CORNER N₄
COUNTY Douglas OREGON

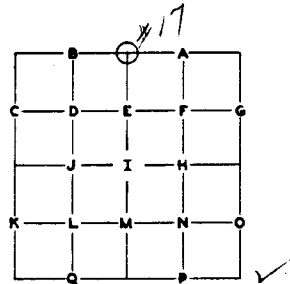

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

| | BEARING | FEET | ORIG. B.T. | "W" NAIL | PLATE | BRASS DISC |
|-------------|---------|------|------------|----------|-------|------------|
| 18" Hemlock | S 6° W | 21.3 | X | X | X | ----- |
| 68" Fir | N80° E | 43.0 | ----- | X | X | ----- |
| | | | | | | |

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Virgin timber

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) S 60° E ON MINUS (-) 30 %

NORTH: + 25% 3' to small dry creek bed

SOUTH: -20%

EAST: -30%

WEST: +35%

FROM CORNER I

WORK DONE FOR W. CO.

FIELD NOTES IN BOOK:

BY: Glen McChesney DATE: October 21, 1964
ENGINEER - SURVEYOR

ASSISTED BY: Robert Barta

COPIES SENT TO:

UNDER THE SUPERVISION OF:

SEAL PAGE 3

GLO SURVEY RECORD

DATE: 1894
CORNER 6" x 10" x 12" Basalt Stone

PRESENT CONDITION - (DESCRIBE FULLY -
USE PAGE 2 IF NEEDED FOR EXPLANATION.)

Found lying on top of ground
Found chisel marks " $\frac{1}{4}$ "

ACCESSORIES:

| | BEARING- | LINKS- | FEET- | |
|-------------|----------|--------|-------|------------------------------------|
| 20" Hemlock | S 7° W | 33 | 21.8 | Found 18" Hemlock scribing visible |
| 14" Hemlock | N12° W | 35 | 23.1 | Found 20" Hemlock scribing visible |
| | | | | |

SURVEY RECORD
DATE:

PRESENT CONDITION:

CORNER SET: Reset stone in the ground MAG. DECL.: 20°
3" x 3" x4' Hemlock Post

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

| BEARING- | FEET- | SURVEY - | |
|----------|-------|----------|------------------------------|
| S 6° W | 21.8 | GLO | 18" Hemlock Face measurement |
| N 9° W | 23.1 | " | 20" Hemlock " " |
| | | | |

CS 53/110-2