


# PUBLIC LAND CORNERS

SPRINGFIELD  
SURVEY FILE

WEYERHAEUSER COMPANY  
SPRINGFIELD BRANCH

TOWNSHIP 24 S RANGE 3 W  
SECTION 22 CORNER S W  
COUNTY Douglas OREGON

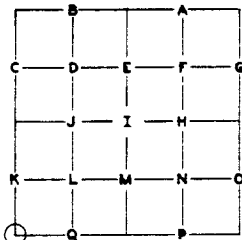

ACCESSORIES ADDED THIS DATE: 1953

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
50" Fir stump	S 41° E	32.5	—	X	X	—
50" Fir stump	S 53° W	57.0	—	X	X	—
20" Red Cedar	N 69° W	57.2	—	X	X	—

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: young reproduction  
(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)  
SLOPE FACES (GIVE BEARING IN DEGREES) North ON MINUS (-) 50 %

FROM CORNER —

NORTH: 60' to rocked logging road  
85' to post and plate on North side of road

SOUTH: \_\_\_\_\_

EAST: \_\_\_\_\_

WEST: \_\_\_\_\_

WORK DONE FOR W. CO.

FIELD NOTES IN BOOK: \_\_\_\_\_

BY: Elen M. Cheney DATE: April 16, 1964

ENGINEER - SURVEYOR  
Lund Agent

ASSISTED BY: Robert Barta

UNDER THE SUPERVISION OF:

COPIES SENT TO: \_\_\_\_\_

SEAL

PAGE 3

## GLO SURVEY RECORD

DATE: 1883  
CORNER Post

PRESENT CONDITION - (DESCRIBE FULLY -  
USE PAGE 2 IF NEEDED FOR EXPLANATION.)

Gone

### ACCESSORIES:

	BEARING-	LINKS-	FEET-	
18" Hemlock	N 51° E	45	29.7	Gone
30" Hemlock	S 70° E	55	36.3	Gone
15" Cedar	S 80° W	55	36.3	Gone
30" Hemlock	N 21° W	5	3.3	Gone

## C. S. SURVEY RECORD

DATE: 1939  
Set rock pile from which:

PRESENT CONDITION: April 16, 1964

16" Cedar	S 40° W	27.0'	Dead down 11" R. Cedar stub - scribing visible (slid down hill)
6" Yew	West	44.0'	10" Yew standing - scribing visible (slid down hill)

SEE PAGE 2

CORNER SET: 1 1/2" iron pipe and 1 1/2"x11" yellow MAG. DECL.: 20°  
marker pipe.

### BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY -	
S 81° W	9.0	1939	10" down Red Cedar stub
N 69° W	43.5	1939	10" Yew Face measurement

PAGE 1

CS 53/111-23