


SPRINGFIELD  
 SURVEY FILE

# PUBLIC LAND CORNERS

WEYERHAEUSER TIMBER COMPANY  
 SPRINGFIELD BRANCH

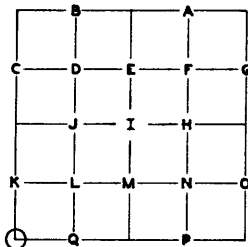

TOWNSHIP 25S RANGE 2W

SECTION 14 CORNER SW

COUNTY Douglas OREGON

### GLO SURVEY RECORD

DATE: 1900  
 CORNER Post

PRESENT CONDITION - (DESCRIBE FULLY -  
 USE PAGE 2 IF NEEDED FOR EXPLANATION.)

Gone

### ACCESSORIES:

	BEARING-	LINKS-	FEET-	
8" Pine	N46E	6	4.0	18" Pine - lower face not open re-scribed upper face
6" Hemlock	S67E	31	20.5	8" x20' Hem snag - original scribing visible
8" Hemlock	S51W	22	14.5	Rotted Hem stump
7" Pine	N35W	18	11.9	26" Pine - faces healed over re-scribed

### SURVEY RECORD

DATE:

PRESENT CONDITION:

found in field:  
 Douglas Co. Brass Cap 1958  
 10" Hemlock - scribed "CS" 1958  
 16" Pine - scribed 10 years ago

CORNER SET: Brass cap set by Douglas County Surveyor - MAG. DECL.: 20°  
 Also scribed cedar post

### BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY -	
N42E	4.0	GLO 1900	18" Pine
S66E	20.0	GLO 1900	8" Hem snag
S56W	14.5	GLO 1900	Hem stump
N35W	11.9	GLO 1900	26" Pine
S84E	37.6	Douglas Co.	10" Hem
S27W	18.3	--	16" Pine

PAGE 1

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
18" Sugar Pine	N38E	3.6	X	X	X	--
10" Hemlock	S84E	37.5	CS	X	X	--
16" Sugar Pine	S27W	17.9	CS	X	X	--
26" Sugar Pine	N36W	11.5	X	X	X	--

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Salal, Rhododendron

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) West ON MINUS (-) 7 %

NORTH: - 4%

SOUTH: - 6%

EAST: - 1% old growth to North, recently logged to South

WEST: - 7% old growth North and South

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK:

BY: Glen McChesney DATE: 8/17/59  
 ENGINEER SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY:

COPIES SENT TO:

SEAL PAGE 3

CS 53/112-49

34