

9


PUBLIC LAND CORNERS

SPRINGFIELD
SURVEY FILEWEYERHAEUSER TIMBER COMPANY
SPRINGFIELD BRANCH

TOWNSHIP 25S RANGE 3W

SECTION 26 CORNER NW

COUNTY Douglas OREGON

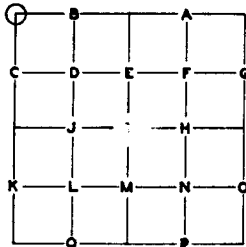

GLO SURVEY RECORD

DATE: 1883

CORNER Cedar Post

PRESENT CONDITION - (DESCRIBE FULLY -
USE PAGE 2 IF NEEDED FOR EXPLANATION.)

No trace

ACCESSORIES:

	BEARING-	LINKS-	FEET-	
24" Fir	N40E	59	38.9	Gone
18" Hem	S10E	37	24.4	Gone
36" Fir	S63W	27	17.8	40" Fir Snag - Scribing visible
10" Cedar	N65W	29	19.1	22" I Cedar - face partly healed over

GLO RESURVEY RECORD

DATE: 1943

PRESENT CONDITION:

Set Brass Cap	Found
12" Hem N21E 20lks - 13.2"	14" Hem - scribing visible
38" Fir S20E 56lks - 37.0	40" Fir - scribing visible
12" Hem S23W 24lks - 15.8	14" Hem scribing visible
10" Hem N77W 54lks - 35.6	12" Hem - down

CORNER SET: Brass cap set from original SW and NW BTS MAG. DECL.:
by Glo resurvey 1943.

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
S60W	17.8	1883	Distance to face - 40" Fir Snag
N64W	19.1	1883	Distance to face - 22" In. Cedar
N22E	13.3	1943	Distance to center - 14" Hem
S20E	37.0	1943	Distance to center - 40" Fir
S23W	15.8	1943	Distance to center - 14" Hem
N77W	35.6	1943	Distance to roothole - Down 12" Hem

PAGE 1

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
14" Hem	N20E	13.0	1943	X	X	-
8" Hem	S44E	49.1	-	X	X	-
14" Hem	S22W	15.4	1943	X	X	-
22" I. Cedar	N65W	18.6	X	X	X	-

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Salal, brush

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) Level ON MINUS (-) %

NORTH: _____

SOUTH: _____

EAST: S60E 240' to fire access road - BLM plate.

WEST: _____

WORK DONE FOR W. T. CO.:

FIELD NOTES IN BOOK: _____

BY: Glen McChesney DATE: July 28, 1959
ENGINEER-SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY: _____

COPIES SENT TO: _____

SEAL

PAGE 3

CS 53/1139