


PUBLIC LAND CORNERS

WEYERHAEUSER COMPANY
SPRINGFIELD BRANCH

TOWNSHIP 25 S RANGE 3 W
SECTION 24 CORNER V 1
COUNTY Douglas OREGON

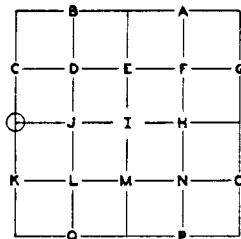

GLO SURVEY RECORD			PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)		
DATE: <u>1882</u>					
CORNER <u>Dogwood Post</u>			<u>Gone</u>		
ACCESSORIES:					
	BEARING-	LINKS-	FEET-		
<u>12" Fir</u>	<u>N 20 E</u>	<u>18</u>		<u>Gone (known in 1943) see below</u>	
<u>36" Fir</u>	<u>S 65 E</u>	<u>25</u>		<u>Gone (known in 1943)</u>	
GLO SURVEY RECORD					
DATE: <u>1943</u>					
<u>1" iron pipe with brass cap</u>			<u>Found</u>		
<u>60" Fir N 20 E 27 lks 17.8 ft.</u>			<u>Windfall</u>		
<u>36" Fir S 65 W 74 lks 48.8</u>			<u>44" Fir with broken top</u>		

CORNER SET: Brass Cap MAG. DECL.: 20° E

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-
<u>S 65 W</u>	<u>48.1</u>	<u>1943</u>

PAGE 1

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20° E

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
<u>44" Fir</u>	<u>S 44 E</u>	<u>51.5</u>	<u>--</u>	<u>X</u>	<u>X</u>	<u>--</u>
<u>40" Fir</u>	<u>N 31 W</u>	<u>54.5</u>	<u>--</u>	<u>X</u>	<u>X</u>	<u>--</u>

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Timbered
(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)
SLOPE, FACES (GIVE BEARING IN DEGREES) S 30 E ON MINUS. (-) 25%

NORTH: 7 16 70' to spur road into see 24
SOUTH: - 20
EAST: - 24
WEST: 7 2

WORK DONE FOR W. CO.

FIELD NOTES IN BOOK:

BY: M. D. Hale DATE: 14 Nov. '62
ENGINEER-SURVEYOR

UNDER THE SUPERVISION OF:

ASSISTED BY: Titeomb, Jordan, Scott & Case

COPIES SENT TO:

SEAL PAGE 3

CS 53/113-12

12