


SPRINGFIELD
 SURVEY FILE

PUBLIC LAND CORNERS

WEYERHAEUSER COMPANY
 SPRINGFIELD BRANCH
 TOWNSHIP 26 S RANGE 2 W
 SECTION 8 CORNER S 1/4
 COUNTY Douglas OREGON

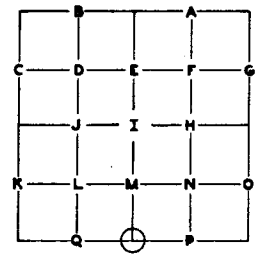

ACCESSORIES ADDED THIS DATE: _____ MAGNETIC DECLINATION 20°

	BEARING	FEET	ORIG. B.T.	"W" NAIL	PLATE	BRASS DISC
18" Fir	N 55° W	10.0	1959 X	X	X	--
16" Fir	S 41° E	21.0	1959 X	X	X	--

IDENTIFIED ON PHOTO: _____

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Salal
 (USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)
 SLOPE FACES (GIVE BEARING IN DEGREES) South ON MINUS (-) 41 %

NORTH: + 66%; Uncut 2nd Gr. Fir and Scattered O.G. Fir; 100' to SW Cor. of rocky opening and skid road; 250' squared stake marked "1/4 Sec. 8/16" Blazed line to C 1/16 S corner marked by Iron Pipe.
 SOUTH: - 41%; Mixed stand 2nd Gr. and O.G. fir uncut; 120 feet to base of steep slope and North edge of flat; Blazed line
 EAST: 0%; Blazed line
 WEST: 0%; Blazed line; 6.2 squared stake

GLO SURVEY RECORD				PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)
DATE: <u>1959</u>				
CORNER <u>Brass Cap</u>				<u>Good condition</u>
ACCESSORIES:				
BEARING-	LINKS-	FEET-		
20" Fir	N 53 1/2° W	17	11.2	<u>Good condition, but is 18" tree</u>
15" Fir	S 41° E	34	22.4	

M.C. Ramsey R.S. No. 404 SURVEY RECORD				PRESENT CONDITION:
DATE: <u>1960</u>				
<u>Found above brass cap and same</u>				
<u>BT's noted as follows:</u>				
<u>18" Fir</u>	<u>S 43° E</u>	<u>33 links</u>	<u>(21.8')</u>	
<u>20" Fir</u>	<u>N 55° W</u>	<u>17 "</u>	<u>(11.2')</u>	

From above identified CORNER, ~~SEEK~~ I find as follows _____ MAG. DECL.: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:			
BEARING-	FEET-	SURVEY -	
N 55° W	10.0	1959	18" Fir B.T.; measured to face
S 41° E	21.0	"	16" " " ; " " "

WORK DONE FOR W. CO. _____ FIELD NOTES IN BOOK: _____
 BY: William S. Mills DATE: 6/22/61
REGISTERED SURVEYOR
Land Agent
 ASSISTED BY: _____
 COPIES SENT TO: _____

UNDER THE SUPERVISION OF: _____

CS 53/114-7