


SPRINGFIELD
 SURVEY FILE

PUBLIC LAND CORNERS

WEYERHAEUSER COMPANY
 SPRINGFIELD BRANCH

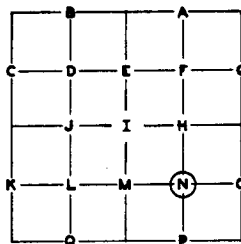

TOWNSHIP 26 S RANGE 2 W
 SECTION 8 CORNER SE 1/16
 COUNTY Douglas OREGON

GLO SURVEY RECORD

CORNER _____ DATE: _____

PRESENT CONDITION - (DESCRIBE FULLY -
 USE PAGE 2 IF NEEDED FOR EXPLANATION.)

ACCESSORIES:

BEARING-	LINKS-	FEET-

M. C. Ramsey
 R.S. No. 404 SURVEY RECORD
 DATE: 1960

PRESENT CONDITION:

I, Pipe 1" x 3' at corner from which

Corner pipe good condition

BT's
 22" D. Fir S 47° E 28 links (18.5)
 14" D. Fir N 5° W 41 " (27.1)

Both BT's in good condition; plainly scribed

From above identified
 CORNER SET: I find as follows

MAG. DECL.: 20°

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

BEARING-	FEET-	SURVEY-	
S 47° E	17.2	1960	M.C. Ramsey BT; measured to face; 22" D. Fir
N 5° W	26.9	1960	" " " " " " 14" D. Fir

PAGE 1

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20°

	BEARING	FEET	DATE B.T.	"W" NAIL	PLATE	BRASS DISC
22" D. Fir	S 47° E	17.2	Ramsey 1960	X	X	—
14" D. Fir	N 5° W	26.9	Ramsey 1960	X	X	—

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Salal

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) West ON MINUS (-) 50 %

NORTH: + 11%; Uncut O.G. fir to West; logged with scattered residual 2nd Gr. D. fir to East; good blazed line Ramsey calls N 1° 28' E 21.28 Ch. to CE 1/16 Cor.

SOUTH: + 9%; Logged with residual 2nd Gr. D. fir to East; to West is uncut large 2nd Gr. fir for 50', thence in 6-8 year old logging as above.

EAST: + 35% for 30' to top ridge bearing N and S

WEST: - 50%; for 400' strip uncut mixed 2nd Gr. and O.G. fir on South; Uncut O.G. North; good blazed line Ramsey calls S 86° 54' W 19.98 Ch. to CS 1/16 Cor.

WORK DONE FOR W. CO.

FIELD NOTES IN BOOK:

BY: William H. Jones DATE: 6/22/61

WYERHAEUSER SURVEYOR
 Land Agent

ASSISTED BY:

UNDER THE SUPERVISION OF:

COPIES SENT TO:

SEAL PAGE 3

CS 53/114-8