


PUBLIC LAND CORNERS

WEYERHAEUSER COMPANY
SPRINGFIELD BRANCH

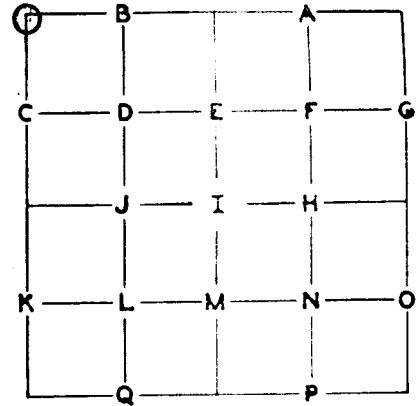

TOWNSHIP 26 South RANGE 3 West
SECTION 24 CORNER NW
COUNTY Douglas OREGON

GLO SURVEY RECORD
DATE: 1882
CORNER Fir post

PRESENT CONDITION - (DESCRIBE FULLY - USE PAGE 2 IF NEEDED FOR EXPLANATION.)

No trace

ACCESSORIES:

| | BEARING- | LINKS- | FEET- |
|-----------|----------|--------|-------|
| 30" Cedar | N 70 E | 58 | 38.3 |
| 30" Cedar | S 82 E | 19 | 12.5 |
| 12" Cedar | S 78 W | 85 | 56.1 |
| 24" Cedar | N 19 W | 170 | 112.2 |

Cedar shell 5' high - badly burned
38" leaning Red Cedar - No visible scribing
No trace
Shell of 36" Incense Cedar - axe marks but no visible scribing

Weyerhaeuser Co. **SURVEY RECORD**
DATE: August 1951
Curt Price found scribing on the SE Bt and evidence of NE and NW Bts and set 2 1/2" Cedar post S 82 E 19 lks from identified SE Bt
Weyerhaeuser Co. ref: 28" Cedar S 36 E 37.5'
32" Fir N 65 E 40.4'
14" Fir N 84 W 31.6'
24" Fir S 22 W 57.5'

PRESENT CONDITION:
Found
Found - renewed plate Same bearing & distance
Found - renewed plate Same bearing & distance
Found - renewed plate Same bearing & distance
Found - renewed plate Same bearing & distance


CORNER SET: 2 1/2" Cedar post as found MAG. DECL.: 20

See Page 2 for Douglas County renewal

BEARING AND DISTANCE TO ABOVE IDENTIFIED SURVEY ACCESSORIES:

| BEARING- | FEET- | SURVEY - | |
|----------|-------|----------|---------------|
| N 73 E | 41.0 | GLO | Ctr. of stump |
| S 82 E | 12.5 | GLO | Ctr. of stump |
| N 15 W | 118.6 | GLO | Ctr. of stump |
| | | | |
| | | | |
| | | | |

SECTION 24 TOWNSHIP 26 South RANGE .3 West

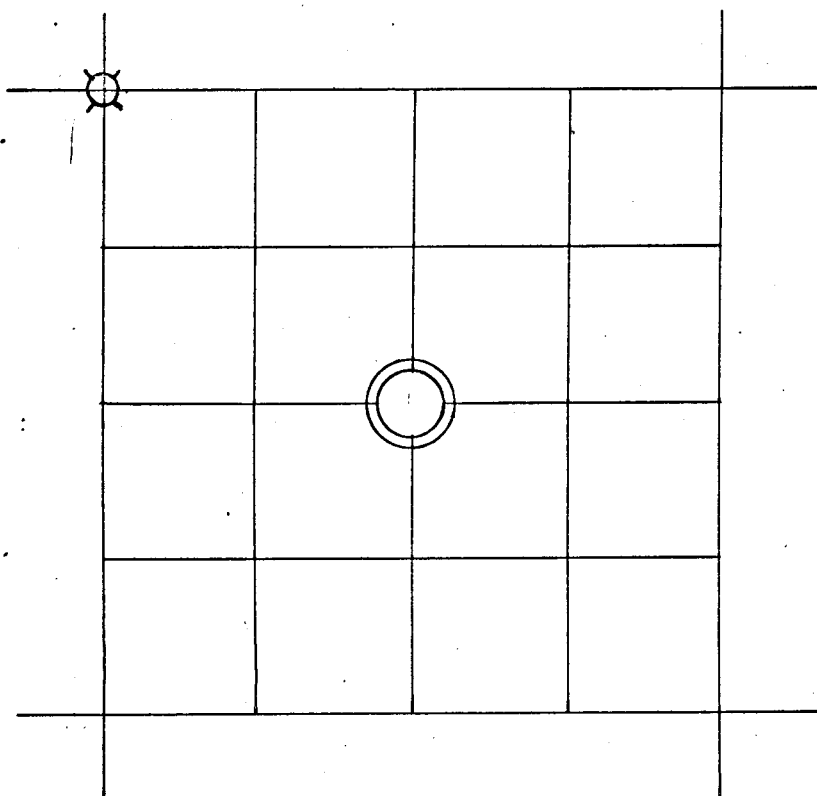

— // — // — // — LINE MARKED BY NOTCH CUT IN BLAZE.

○ — KNOWN CORNER.

⊗ — REFERENCED CORNER BY WEYERHAEUSER METHOD.

Douglas County Renewal - 6/65 - *Rem # 117*

Set brass cap at former position of 2½" Cedar post as set by Weyerhaeuser Company,

August, 1951 and scribed four new Bts

| | | |
|-------------|--------|-------|
| 18" Fir | N 87 W | 31.0' |
| 12" Hemlock | N 10 E | 10.0' |
| 10" Fir | N 24 W | 34.6' |
| 28" Cedar | S 40 E | 39.1' |

ACCESSORIES ADDED THIS DATE:

MAGNETIC DECLINATION 20

| | BEARING | FEET | ORIG. B.T. | "W" NAIL | PLATE | BRASS DISC |
|--|---------|------|------------|----------|-------|------------|
| | | | | | | |
| | | | | | | |
| | | | | | | |
| | | | | | | |

IDENTIFIED ON PHOTO:

INFORMATION ON LOCATION OF CORNER AS NOW SET:

GROUND COVER: Creek bottom

(USING FORM LINES SKETCH TOPOG AT CORNER ON PAGE 2 PLAT)

SLOPE FACES (GIVE BEARING IN DEGREES) North ON MINUS (-) 10 %

FROM CORNER -

NORTH: Down creek bottom

SOUTH: 50' to creek C-N 10 E

EAST: 15' to creek C-N

WEST: + 50%

WORK DONE FOR W. CO.

FIELD NOTES IN BOOK:

BY: Glen McChesney

DATE: 6/65

ENGINEER SURVEYOR
LAND AGENT

ASSISTED BY:

FILED

RECEIVED

OCT 19 1965

COUNTY SURVEYOR
DOUGLAS COUNTY, ORE.

COPIES SENT TO:

UNDER THE SUPERVISION OF:

SEAL