

M 96-63 A+B

FILED  
RECEIVED *al*

OREGON CORNER RESTORATION FORM


JUN 6 1984

Section 28 Township 21S Range 11W

COUNTY SURVEYOR  
DOUGLAS COUNTY, ORE.

County Douglas Date 4-17-84

Corner Designation

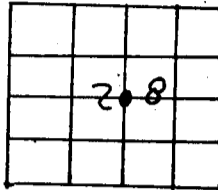

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals/Surveys, etc. NONE

Monument(s) & Accessories Found: (Condition and Source)


NONE

Monument Detail

Set 2" alum. cap on  $\frac{1}{2}$ "x18" iron rod. Rock mound.

Set W.C.-3" alum. cap in  $2\frac{1}{2}$ " x 30" alum. pipe bears S87°13'30" W 42.26 ft. on line from true cor.

Sketch

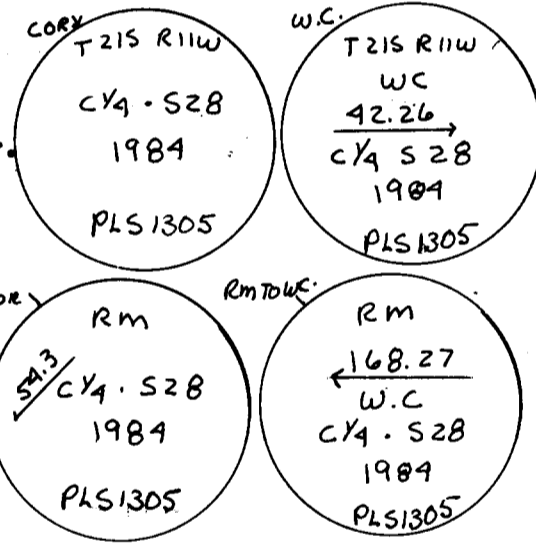

Monument Set (Procedures and Description)

Set by survey and subdivision of Section 28.

New Accessories

Scribed BT to true corner: 10" D. Fir bears S 47° E 20.0 ft. scribed C $\frac{1}{4}$  S28 BT

Scribed BT's to W.C.: 13" D. Fir brs. N 58° W 14.2 ft., scribed X BT

10" D. Fir brs S 45° W 4.8 ft., scribed X BT

Set R.M. to true cor- 2" alu. cap on  $\frac{1}{2}$ "x18" I.R. brs N 78°29'07" E 54.3 ft.

Set R.M. to W.C. - 3" alum. cap on  $2\frac{1}{2}$ " x 30" alum. pipe brs N 75°29'44" E 168.27 ft.

Location & Comments

Set from survey for U.S. Forest Service

Compass Declination 19°50'E

Firm/Agency Jackson & Prochnau, Inc.

Address P.O. Box 177

Albany, Ore. 97321

Party Chief K. Kendall

Notes \_\_\_\_\_

Witness Larry Griensewic

Surveyor's Seal

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*James W. Prochnau*

OREGON  
SEPTEMBER 21, 1977  
JAMES W. PROCHNAU  
1305

5 #190