

DATE: 8-30-78

COUNTY SURVEYOR'S OFFICE  
T30S R2W  
1/4 513

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

(NORTH 1/4 COR. SEC 13)  
ONLY

1978

Previous Renewal #'s 54

Monument(s) Found: (Condition and Source) 1" x 30" IRON  
PIPE SET FIRMLY ALONGSIDE A 6" x 8" x 12"  
STONE.

Accessories Found: (Condition and Source) ORIGINAL B.T.,  
A 23" DOUG FIR ~~STUMP~~ BEARS S77°E, 33.6 FT.

SCRIBING VISIBLE ON PREVIOUSLY OPENED  
BLAZE, "S 13 BT". B.T.'s SET BY  
MARKHAM IN 1960, A 17" CEDAR BEARS  
N17°W, 27.4 FT. SCRIBING VISIBLE ON A  
PARTIALLY HEALED BLAZE, "BT 1/4 S". ON A SINGLE B. BLAZE.

#2174

Page 1 of 1

C. S. File No. 60/11-34 C

A 12" FIR STUMP BEARS S 2° W, 51.2 FT.  
SCRIBING VISIBLE, "B".

RENEWAL

Monument Set: (Procedure and Description) ~~MOVING IT~~

I REFERENCE THE IRON PIPE, & MOVING IT  
ASIDE, I REPLACE IT WITH A 1 1/2" IRON  
PIPE WITH A 2 1/2" BRASS CAP ATTACHED.

BRASS CAP IS STAMPED AS SHOWN ON THE  
REVERSE. I BURY THE STONE & 1" PIPE  
ALONGSIDE THE BRASS CAP.  
New Accessories: (Description)

A 6" DOUG FIR BEARS S 33° 30' E,  
46.0 FT. SCRIBED " 1/4 S 13 CSBT"  
ON A DOUBLE BLAZE.

I PLACED COUNTY B.T. SIGNS ON ALL BT'S  
& BT STUMPS.

Location and Comments:	<u>15° E (SEE COMMENT)</u>	Compass Declination
LOCAL ATTRACTION	<u>U.S. F.S.</u>	Agency
CREATED BY A	<u>DENNY'S GAYLORD</u>	Party Chief
STEEL FENCE	<u>" "</u>	Notekeeper
POST SETTING 1.2 FT	<u>JAMES DAVIS</u>	Witnesses
EAST OF THE		
CORNER.		

Index File No. J-23


CORNER RECORD (SEARCH)  
(Ref. FSM 7151.4)

Tract or Survey No. \_\_\_\_\_ Cor. No. \_\_\_\_\_

T 30S R. 2W R.D. TULLER County DOUGLAS

Merid. \_\_\_\_\_ N.F. UMPOVA State \_\_\_\_\_

CORNER DIAGRAM

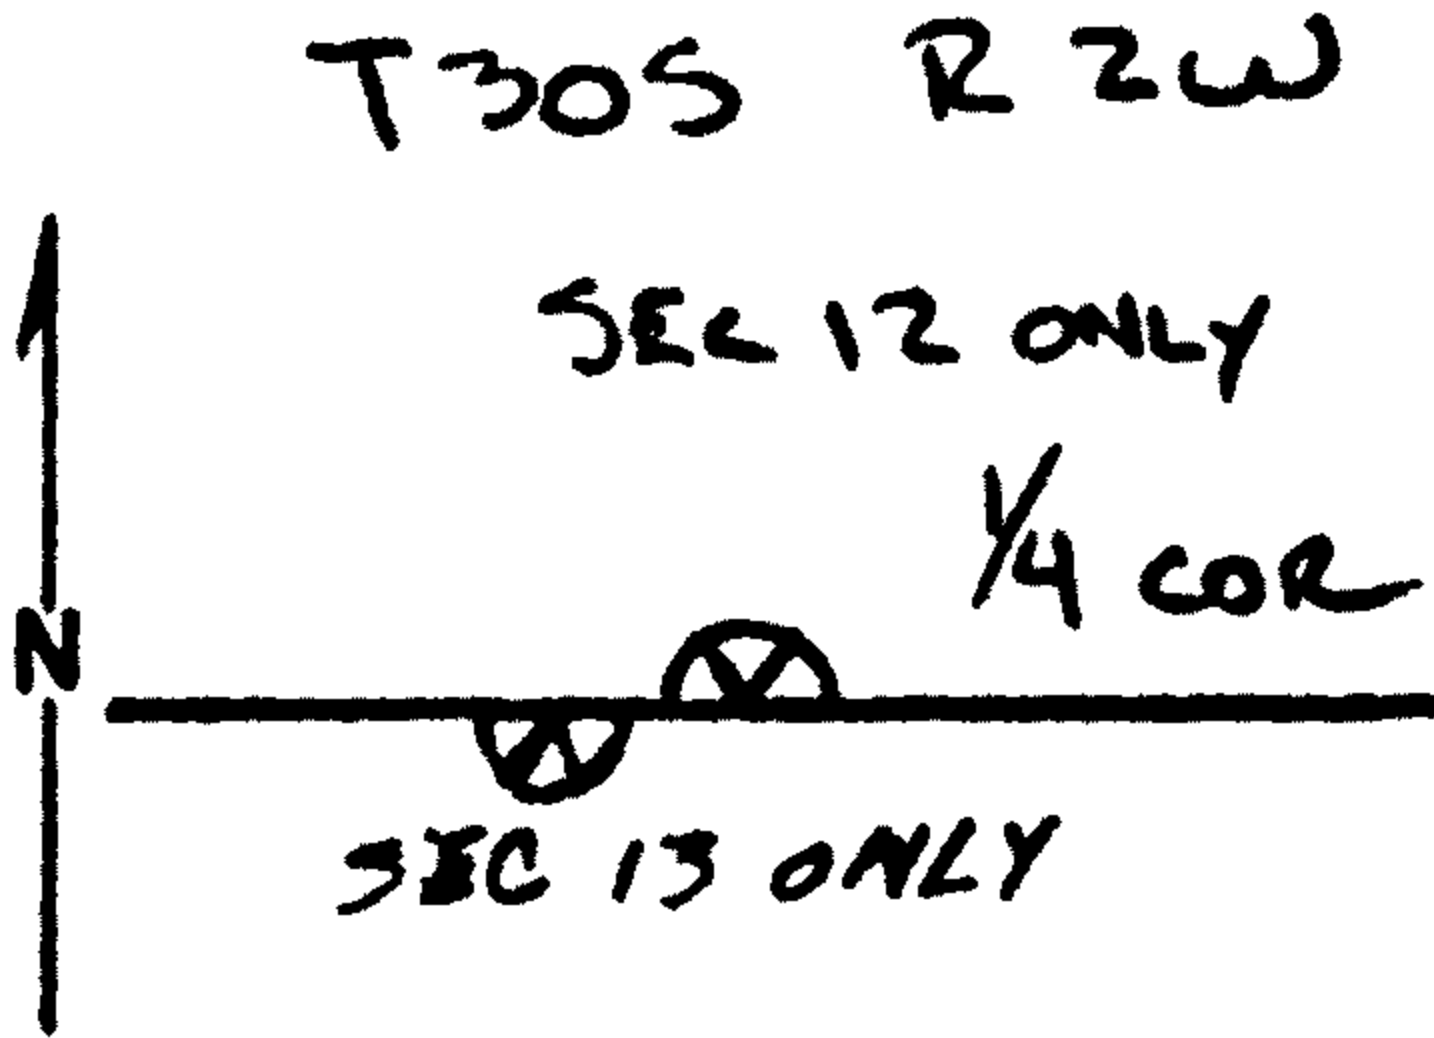

DESCRIBE CORNER MONUMENT FOUND

South  $\frac{1}{4}$  Corner Section 12 only, as det. by O.B.T.  
 20" Fir, uproot, N.40°E. 5.9 ft., fd. scribe  
 At Corner Point Set  $\frac{1}{2}$ " x 30" Iron Pipe from which:  
 9" Cedar S.21°W. 36.5 ft. mkd.  $\frac{1}{4}$  S12 R.T.  
 28" Cedar N.47°W. 41.0 ft. mkd.  $\frac{1}{4}$  S12 R.T.  
 North  $\frac{1}{4}$  Corner 13 bears West 58.0 ft. distance.

J-23 53  
 Markham, Jr  
 3-24-60

North  $\frac{1}{4}$  Corner Section 13 only, as det. by O.B.T.  
 33" Fir S.77°E. 33.6 ft. O.B.T., fd. scribe.

J-23 54

PHOTO IDENTIFICATION

Photo No. \_\_\_\_\_  
 Filed At. \_\_\_\_\_  
 Object Ident. \_\_\_\_\_  
 Ident. By \_\_\_\_\_

At Corner Point Found Stone and Set  $\frac{1}{2}$ " x 30" Iron Pipe from which:  
 14" Cedar N.17°W. 27.8 ft. mkd.  $\frac{1}{2}$  S13 R.T.  
 10" Fir S. 4°W. 52.0 ft. mkd.  $\frac{1}{2}$  S13 R2W R.T.  
 South  $\frac{1}{4}$  Corner 12 bears East 58.0 feet distance.

Markham  
 3-24-60

PLANE COORDINATE POSITION DATA

State \_\_\_\_\_ Zone \_\_\_\_\_  
 X \_\_\_\_\_  
 Y \_\_\_\_\_  
 Estab. By \_\_\_\_\_ Agency \_\_\_\_\_

Signature \_\_\_\_\_ Title \_\_\_\_\_ Division \_\_\_\_\_ Headquarters \_\_\_\_\_ Date \_\_\_\_\_