



M 108-69

Office 476-2425

**MAX H. HULL Land Surveying**

231 N. W. 'B' Street Grants Pass, Oregon 97526

SURVEY NARRATIVE to comply with Paragraph 209.250, O.R.S.

**FILED**

*jh*

DATE: August 30, 1989

SEP 27 1989

*✓*

FOR: Gregory Forest Products  
P.O. Box "C"  
Glendale, Oregon

**COUNTY SURVEYOR  
DOUGLAS COUNTY, ORE.**

PURPOSE: To survey and mark boundary lines on property located in Section 7, Township 32 South, Range 7 West, Willamette Meridian, Douglas County, Oregon.

PROCEDURE: Beginning at the South 1/4 Corner at which point I found a 1978 B.L.M. brass cap from which I found

A Live Oak 10" in diam. North 55 1/2° West 44.88 feet blaze healed

A Fir 15" in diam. South 7 1/4° East 26.4 feet blaze healed

Thence I surveyed to the East 1/16 Corner at which point I found a 1978 B.L.M. brass cap from which I found

A Fir 7" in diam. North 49 1/2° East 14.52 feet blaze healed

A Fir 8" in diam. South 74 1/2° West 9.24 feet blaze healed

Thence I surveyed to the Southeast Section Corner at which point I found a 1978 B.L.M. brass cap from which I found

A Fir 11" in diam. North 32 1/2° East 31.68 feet blaze healed

A Fir 18" in diam. South 34° East 35.97 feet blaze healed

A Fir 20" in diam. South 59° West 61.71 feet blaze healed

A Fir 9" in diam. North 56 1/2° West 16.83 blaze healed

Thence I surveyed to the South 1/16 Corner at which point I found a 1978 B.L.M. brass cap from which I found

A Fir 8" in diam. North 28 1/2° East 27.72 feet blaze healed

A Fir 8" in diam. South 84 1/2° West 73.92 feet blaze healed

C.S. File No. 63/24-8A



**MAX H. HULL Land Surveying**

FILED

*df*

Office 476-2425

SEP 27 1989

231 N. W. ~~30<sup>th</sup> Street~~ Grants Pass, Oregon 97526  
**COUNTY SURVEYOR**  
DOUGLAS COUNTY, ORE.

Thence I surveyed to the East 1/4 Corner at which I found a 1978 B.L.M. brass cap North  $72^{\circ} 43' 32''$  West 7.58 feet from true position; Thence I surveyed to the Northeast Section Corner at which point I found a 1968 County Surveyor brass cap from which I found

- A S. Pine 25" in diam. North  $68^{\circ}$  East 21.1 feet blaze healed
- A S. Pine 24" in diam. South  $15^{\circ}$  West 6.6 feet blaze healed
- A S. Pine 30" in diam. South  $52^{\circ}$  East 17.2 feet blaze healed
- A Laurel 24" in diam. North  $62^{\circ}$  West 25.1 feet blaze healed

Thence I calculated and set said East 1/4 corner in its correct position as shown on the map; thence from the Northeast section Corner I surveyed to the North 1/4 Corner at which point I found a 1978 B.L.M. brass cap from which I found

- A Fir 10" in diam. North  $60^{\circ}$  East 21.12 feet blaze healed
- A Fir 10" in diam. South  $59\ 1/2^{\circ}$  West 15.18 feet blaze healed

Thence I surveyed to the West 1/16 Corner at which point I found a 1978 B.L.M. brass cap South  $11^{\circ} 54' 58''$  East 6.39 feet from true position; Thence I surveyed to the Northwest Section Corner at which point I found a 1967 County Surveyor brass cap from which I found

- A Laurel 13" in diam. South  $41^{\circ}$  East 4.4 feet Blaze healed
- A Fir 15" in diam. South  $42^{\circ}$  West 19.5 feet blaze healed
- A Fir 13" in diam. North  $56^{\circ}$  West 14.0 feet blaze healed
- A Fir 15" in diam. North  $64^{\circ}$  East 38.0 feet blaze healed



**MAX H. HULL Land Surveying**

FILED

*JK*

Office 476-2425

SEP 27 1989

231 N. W. 'B' Street Grants Pass, Oregon 97526  
**COUNTY SURVEYOR**  
**DOUGLAS COUNTY, ORE.**

Thence I calculated and set the West 1/16 Corner in its correct location as shown on the map; Thence I Surveyed to the North 1/16 Corner at which point I found a 1973 B.L.M. brass cap from which I found

A Y. Pine 22" in diam. South 77 1/2° East 4.29 feet blaze healed

A Y. Pine 19" in diam. South 49 1/2° West 6.93 feet blaze healed

Thence I surveyed to the West 1/4 Corner at which point I found

A Y. Pine 50" in diam. South 4° West 67.3 feet blaze healed

A Y. Pine 10" in diam. North 45° East 18.6 feet blaze healed

Thence I surveyed to the South 1/16 Corner at which point I found a 1973 B.L.M. brass cap from which I found

A Fir 15" in diam South 71 3/4° East 77.88 feet blaze healed


A Fir 14" in diam North 6 1/4° West 44.88 feet blaze healed

None of the 1973 and 1978 B.L.M. Corners Set by proportion fit exactly but all except the East 1/4 Corner and West 1/16 Corner were deemed to be within acceptable tolerance; Thence I computed the Subdivision of the Section as shown on the map; Thence I surveyed true Line Setting 1/16 Corners as indicated.

The Survey was conducted with a Nikon NTD-4 Manual Station.

Survey Map is a Seperate Document.

Basis of bearing is the 1973 B.L.M. Survey of the West Line of the Southwest 1/4, Northwest 1/4.

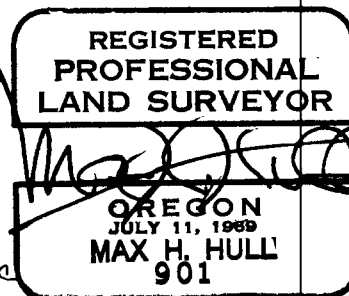

C.S. File No. 63/24-80