

FILED

DEC 21 1987


OREGON CORNER RESTORATION FORM

Section 27 Township 20S Range 9W  
County Douglas Date 11-26-86

COUNTY SURVEYOR  
DOUGLAS COUNTY, ORE.

CORNER DESIGNATION

West  $\frac{1}{4}$  Corner  
Section 27

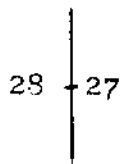

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals/Surveys, etc. William Thiel's 1877 G.L.O. Survey  
and a 1953 G.L.O. Survey. Also survey by Roberts Surveying dated  
September 12, 1983. Renewal form by Roberts Surveying dated 03-13-86


Monument(s) & Accessories Found: (Condition and Source)

Found 1953 G.L.O. Brass Cap up-rooted by recent logging.  
32" Maple Stump, S46E, 21.3' (Scar Vis.), 1953BT. Rec. S43 $\frac{1}{4}$ E, 19.8'  
48" Cedar Stump, N46W, 22.7' (No Marks), 1953BT. Rec. N46W, 21.8'  
8" spike in top of 48" Cedar Stump, N45W, 21.3' to spike.  
8" spike in side of 18" Maple Stump. S79E, 36.9' to spike.

Monument Detail

Sketch

48" CEDAR STUMP

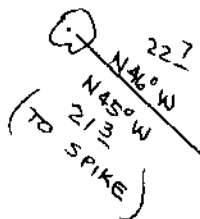

RE-SET 1953  
G.L.O. BRASS  
CAP

18" MAPLE STUMP  
(8" SPIKE)

32" MAPLE STUMP  
(SCAR VIS.)

Monument Set (Procedures and Description)

Re-set 1953 G.L.O. Brass Cap firmly in ground using distances  
of 21.3' and 36.9' from 8" spikes set in 03-13-86. Buried  
purple magnetic marker under iron pipe. Set metal fence post,  
with survey attention sign wired to, beside brass cap.

New Accessories

Location & Comments

Corner lies on steep Compass Declination 20 $\frac{1}{2}$   
East slope about 350' Firm/Agency Roberts  
West of west Branch Surveying Inc.  
Road Address 29 west 29th St.  
Eugene, Oregon 97405  
Party Chief Ted Baker  
Notes  
Witness Jim Metzler

Surveyor's Seal

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Leo Roberts*

OREGON  
AUGUST 29, 1970  
L. D. ROBERTS  
1039

#6 f x