FILED

FEB 25 1988

COUNTY SURVEYOR
DOUGLAS COUNTY, ORE.

OREGON CORNER RESTORATION FORM

Section 36 Township 30 S Range 8 W

County DOUGLAS Date 2/09/88

Corner Designation

R 8 W
W 1/16 | S36 T 30 S
S 1 T 31 S

___Condition Report Only
___Not Found
_X_Renewed
___Unrecorded
___Surveyed In
___Referenced Out

Previous Renewals/Surveys, etc.
Corner set by Howard W. Johnstone (L.S. 498) in 1981
Map on file SEE M 89-79

Monument(s) & Accessories Found: (Condition and Source)
Found monument (5/8 inch iron rod w/Al. cap mkd. as shown) as set by Johnstone in good condition.
(1) 15" d. Fir now 18", scare open and legible, in good condition
(2) 12" D. Fir now a 15" stump, with 10" above ground

Monument Detail

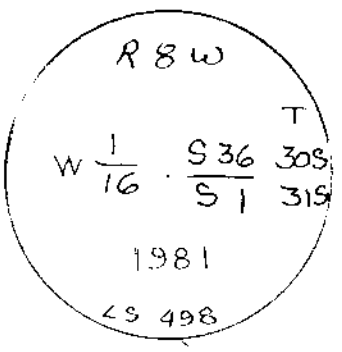

Sketch Bearing Trees
no scale

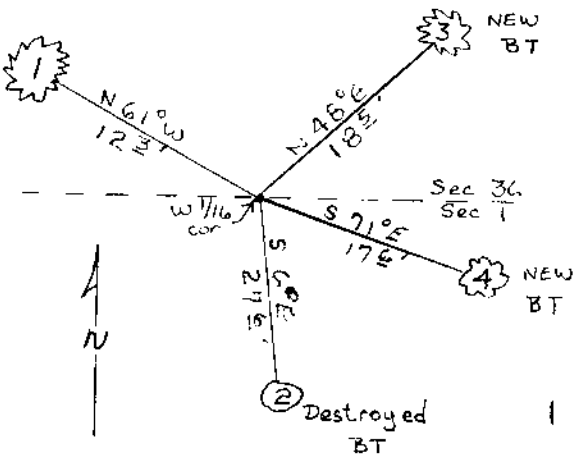

Monument Set (Procedures and Description)
NOT NEEDED

New Accessories
New Bearing Trees
(3) 16" D. Fir, bears N 48° E 18.5 ft., mkd. "W 1/16 S36 BT"
(4) 4" D. Fir, bears S 71° E 17.6 ft., mkd. " X BT "

Location & Comments

Surveyor's Seal

Compass Declination 17° E
Firm/Agency
John H. Markham Jr.
Address P.O. Box 802
Myrtle Creek, OR. 97457
Party Chief Raymond Brown
Notes "
Witness Jim Jenks (C&D Lumber)

REGISTERED PROFESSIONAL LAND SURVEYOR
OREGON
SEPTEMBER 23, 1977
JOHN H. MARKHAM, JR.
1261

C.S. File No. 63/62-5c