

FILED *JL*

OREGON CORNER RESTORATION FORM

MAY 25 1988

Section 11 Township 29S Range 9W  
County DOUGLAS Date 5/1/88

COUNTY SURVEYOR  
DOUGLAS COUNTY, ORE.

Corner Designation

$\frac{1}{4}$   $\frac{S11}{S14}$

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals/Surveys, etc.

#15

RENEWED IN 1959 BY JAMES BYRON, C.S.

Monument(s) & Accessories Found: (Condition and Source)


2 1/2" BRASS CAP WITH 1" I.P., LOOSE IN GROUND FROM LOGGING OPERATIONS; ORIG BT 44" D.F. STUMP W/ ORIG LOWER TRACE VISIBLE BARK SCRIBED "BT" BEARS NORTH 42.5 FT TO CENTER; ORIG BT 32" D.F. VISIBLE BARK FACE, NO SCRIBES BEARS S18°W (ORIG S21°W) 27.8 FT TO CENTER (BYRON 26.4 FT); 1959 BT, 17" D.F. GREEN W/ TOP OUT, UPPER & LOWER FACES HEALED OVER, BEARS SOUTH 35.0 FT TO CENTER; 9" HEM. 1959 BT. ROOT COLLAR VERY ROTTEN, NOT USED (RECORD BEARS N49°W 3.2 FT).

Monument Detail

2 1/2" BRASS CAP WITH 1" IRON PIPE ABOUT 32" LONG WITH FLANGED BASE.

Sketch

COUNTY SURVEYOR'S OFFICE  
T29S R9W

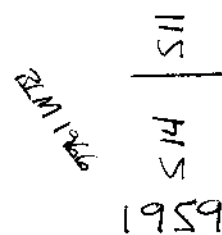

Monument Set (Procedures and Description)

DUG NEW HOLE SET FD. MONUMENT IN 1959 POSITION WITH 12" ABOVE GROUND.

New Accessories

BT'S RETAGGED & PAINTED FLDRESCENT ORANGE.

Location & Comments

Compass Declination 19°E  
 Firm/Agency C.F. MULKINS, TIMBER CRUISING & ENGINEERING  
 Address P.O. Box 750  
Coos Bay, OR 97420  
 Party Chief C.F.M.  
 Notes \_\_\_\_\_  
 Witness \_\_\_\_\_

Surveyor's Seal

5/5/88

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Clyde F. Mulkins*

OREGON  
CLYDE F. MULKINS  
2008

#98 x