

OREGON CORNER RESTORATION FORM

FILED *JB*

NOV 16 1990

Section 12 Township 31 S Range 5 W

County Douglas Date 11/15/90

COUNTY SURVEYOR
DOUGLAS COUNTY, ORE.

Corner Designation

S. 1/16, Sec. 12 (only)
T. 31 S., R 5 W., W.M.

- Condition Report
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals/Surveys, etc. Corner set by B.L.M. in a Dependent Resurvey of the East Boundary of T. 31 S., R. 5 W., W.M.



Monument(s) & Accessories Found: (Condition and Source) At corner found B.L.M. Brass Cap under a 36" log. Corner is in good condition, and is visible from the West side of the log.

Accessories Found (Bearing Trees)

1. 6" Fir, Now a 5 foot tall stump, 7" diam, Bears S 58° W, 25.0 ft. dist., stump has been treated and capped, healed blaze visible, replaced TAG.
2. 36" Fir, Now a 30" tall stump, 38" diam., Bears N 59° W, 77.5 ft. dist., stump has been treated and capped, blaze not visible.

Monument Detail

Sketch NO SCALE

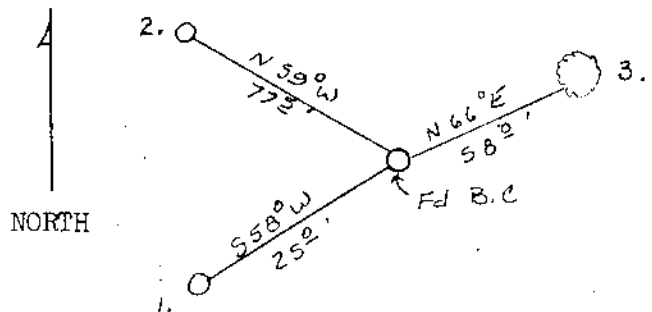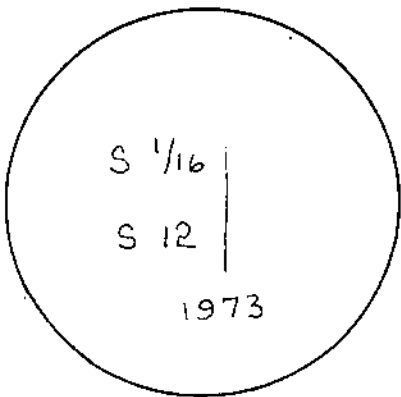

Monument Set: (Procedures and Description) N/A

New Accessories

3. A Fir, 14" diam., Bears N 66° E, 58.0 ft. dist., mkd. S 1/16, S 12, BT.

Location & Comments

Area around corner has been logged in Section 12.
New BT. is for the S 1/16, S 12 (only).

Compass Declination 19° E
Firm/Agency PLS 2391
Raymond F. Brown
Address P.O.Box 539
Canyonville, OR. 97417
Party Chief R. Brown
Notes B. Ike
Witness J. Haight

Surveyor's Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Raymond F. Brown

OREGON
JULY 28, 1989
RAYMOND F. BROWN
2391