

GOVERNMENT CORNER RESTORATION FORM

Date: 4-22-97 By: PC

This survey consists of:

Township 26S Range 6W Sec. 28 County DOUGLAS Map: _____

State OR Date 4-8-97 No. _____

Narrative: _____

Corner Rpt: 64/74-11

Corner Designation

1/4 - 29 / S 28

DOUGLAS COUNTY SURVEYOR

- ____ Condition Report Only
- ____ Not Found
- Renewed
- ____ Unrecorded
- ____ Surveyed In
- ____ Referenced Out

MONUMENT DETAIL

Previous Renewals 1921 + 1956 DCSO

Monument(s) Found:	(Condition and Source)
<u>3/4" I.D. IRON PIPE PROTRUDES 6" ABOVE GROUND (1921)</u>	
<u>2 1/2" DIA. BRASS CAP ON A 1 1/2" O.D. IRON PIPE PROTRUDES 12" ABOVE GROUND. IS FOUND ALONG EAST EDGE OF 1921 I.P. (1956)</u>	
<u>BC APPEARS TO BE PLUMBED OVER 1921 I.P.</u>	

COUNTY SURVEYORS OFFICE
 T26S 6W
 1/4 SEC. 29/28
 COR.
 1956

Accessories Found:

- 10" NOW 24" DIA 2 1/2 FT HIGH ROTTED OAK STUMP NO SCRIBING VISIBLE BEARS S 17 1/2° W, 87.9 FT (REC S 20 3/4° W, 87.9 FT) 1956
- 20" NOW DOWN AND ROTTED OAK NO SCRIBING VISIBLE ROOT HOLE BEARS N 45° E, 26.4 FT (AGREES WITH REC)
- 16" NOW 18" DIA W. OAK WITH A FULLY HEALED SINGLE BLAZE, BEARS S 60° W, 29.0 FT (REC S 62° W, 29.0 FT) 1956
- 12" NOW 15" DIA. W. OAK WITH A FULLY HEALED SINGLE BLAZE, BEARS S 59° E, 34.1 FT (REC S 57° W, 34.1 FT) 1956

Monument Set (Procedure and Description)

Monument Detail

NONE

N/A


New Accessories

15" DIA. DIFIR DOUBLE BLAZED AND SCRIBED
"Y4528 CS BT" BEARS S 30 1/2° E, 35.8 FT

7" DIA MADRONE BARK SCRIBED "Y4529 CS BT"
BEARS N 33° W, 6.8 FT

Sketch of Monument, Accessories, and General Area

Location & Comments

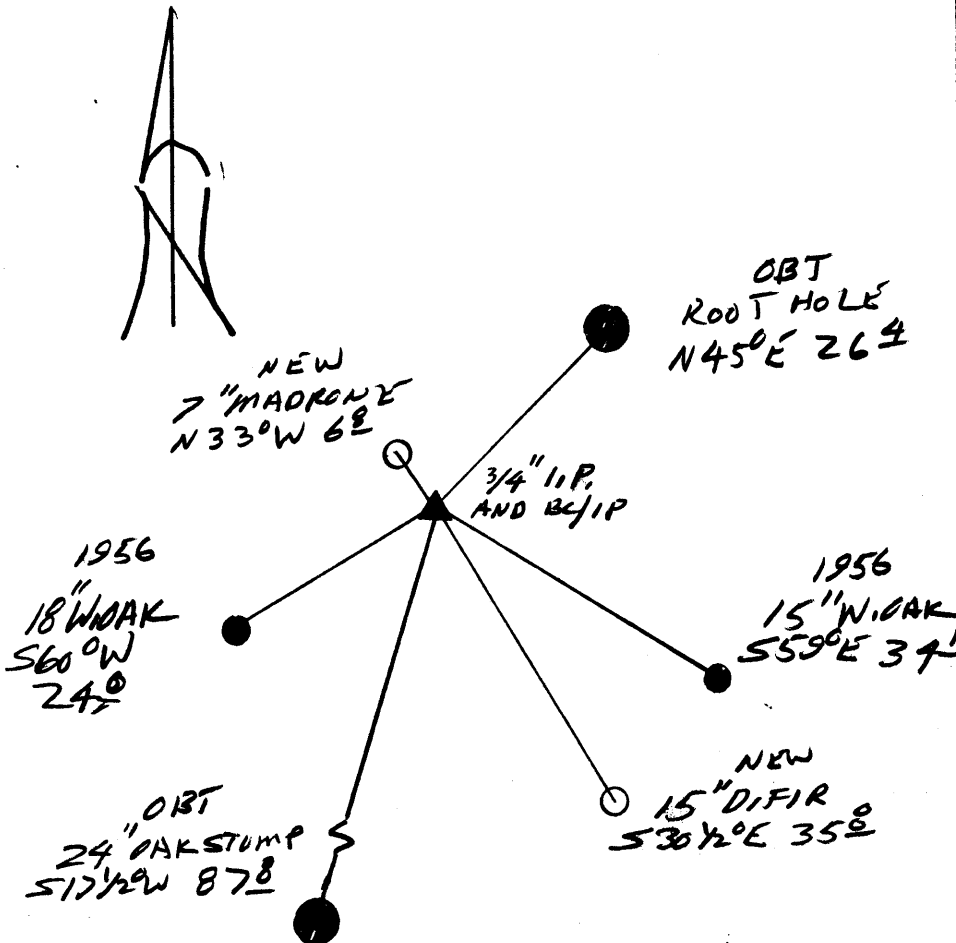

Comp. Declin. 17 3/4° E
 Agency DLSO
 Party Chief RANDALL W. SMITH
 Notekeeper [Signature]
 Witnesses STEPHEN J. FINESE

Address

Surveyor's Seal

REGISTERED
PROFESSIONAL
LAND SURVEYOR

Randall W. Smith
EXPIRES 6-30-98

OREGON
JULY 25, 1990
RANDALL W. SMITH
2489