

FILED

Date: 10-1-2001 By: X

This survey consists of:

Map: _____

Narrative: _____

Corner Rpt: 65/37-25

OREGON CORNER RESTORATION FORM

Section 13 Township 22S Range 12W

County Douglas Date 9/24/01

Corner Designation

E 1/4 Section 13 only

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

DOUGLAS COUNTY SURVEYOR

Previous Renewals/Surveys, etc. CS 55/154

Monument(s) & Accessories Found: (Condition and Source)


3" OSBF brass cap on 1 1/2" galvanized iron pipe

44" D Fir stump with spike in center bears N 51° 16' 31" W 56.55 ft. to spike (healed face) record N 49 1/2° W 55.7 ft to face

36" D Fir stump with spike in center bears S 48° 06' 54" W 86.31 ft. to spike (healed face) record S 49° W 85.5 ft to face

Monument Detail

Sketch

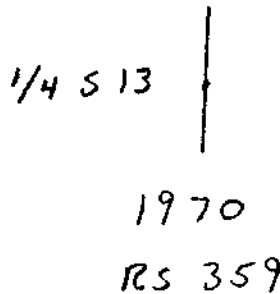

Monument Set (Procedures and Description)

none

New Accessories

10" D. Fir bears N 88° W 4.2 ft blazed, scribed "1/4 S 13 BT"

13" D. Fir bears S 48° E 12.9' blazed, scribed "X BT"

Location & Comments

All bearing trees have red painted band and face plus yellow bearing tree tag. 5 1/2' gal. steel post adjacent to corner.

Compass Declination _____
 Firm/Agency Ward
 North West Inc.
 Address P O Box 105
 Florence OR 97439
 Party Chief Rob Ward
 Notes 01-59
 Witness Ron Rice

Surveyor's Seal



expires 6/30/02
C.S. File No. 65/37-25