CORNER REPORT FORM

Section 8 Township 31S Range 6W.W.M.

Douglas County Date October 19, 2003

CORNER DESIGNATION

200600

Condition Report only
Not Found
x Renewed
Unrecorded
Surveyed In
Referenced out

Previous Renewals/Surveys, etc:

Monument(s) & Accessories Found: (Condition and Source)

2-1/2" brass cap on 1" galvanized iron pipe 10" above grade.
A fir 50" diameter, bears S36E, 24.4 feet. Now a snag with rotten face.
A Madrone snag 22" diameter, bears N16W, 24.4 feet. Now a rotten shell at ground height.
A fir 6" diameter, (bears N77-3/4E, 31.7 feet). Now a windfall with healed face & tag.
A pine 5" diameter, (bears N34-1/4W, 80.5 feet). Now a windfall with healed face & tag.
A unrecorded fir 25" diameter, bears S88E, 20.7 feet with healed face. I place new tag.

FILED
Date: 11-7-2003 By: x
This survey consists of:
Map:
Narrative:
Corner Ref: 65/48-30

DOUGLAS COUNTY
SURVEYOR

Monument Detail

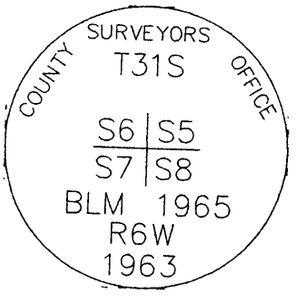


Sketch

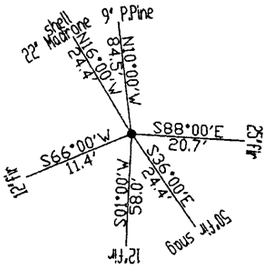


Monument Set (Procedures and Description)

New Accessories

A douglas fir 12" diameter, bears S66W, 11.4 feet face scribed "T31S R6W S7 BT" and tagged.
A douglas fir 12" diameter, bears S1W, 58.0 feet face scribed "T31S R6W S7 BT" and tagged.
A Ponderosa Pine 9" diameter, bears N10W, 84.5 feet face scribed "T31S R6W S6 BT" and tagged.

Location & Comments

Distances to found bearing trees were measured with EDM at approximate side center. New bearing trees were measured to a spike set at approximate side center. Trees were red band and face painted. Found windfalls were not checked for bearing or distance.

Compass Declination 19 East

Firm/Agency: i.e. Engineering, Inc.

Address: 741 SE Jackson
Roseburg, OR 97470

Party Chief: Bruce Webster

Notes:

Witness:

Surveyor's Seal

REGISTERED PROFESSIONAL LAND SURVEYOR

Jerry Lee Estabrook

OREGON
JUNE 30, 1995
JERRY LEE ESTABROOK
2703

Exp. Date 12/31/03

C.S. File No 65/48-30