

OREGON CORNER RESTORATION FORM

Section 36 Township ²³ 24 South, Range 7 West
County Douglas Date 8 July 2010

FILED
Date: 7/15/10 By: JC
This survey consists of:
Map: _____
Narrative: _____
Corner Rpt: 65/69-41

Corner Description

Northeast Corner
Section 36

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

DOUGLAS COUNTY
SURVEYOR

Previous Renewals / Surveys, etc.

Monument (s) & Accessories Found: (Condition and Source)

Found 3-1/4" BLM brass cap dated 1957 with the following accessories:

- 41" W. Red Cedar bears N12°W 11.2' - healed face
- 26" D. Fir bears N73-1/2°E 51.5' - healed face
- 24" W. Red Cedar bears S37°W 56.1' - healed face
- 16" D. Fir bears S33-1/2°E 29.0' - healed face

Monument Detail

Sketch
T20S
R7W R6W
S25 | S30
S36 | S31
1957

Monument Set (Procedures and Description)

None


New Accessories

None

Location & Comments

Corner has steel post _____ Compass Declination 17° East
 adjacent to it. _____ Firm/Agency Ward NorthWest inc.
All BT's have red painted
bands and yellow tags. Address P.O. Box 105
 _____ Florence, OR 97439
 _____ Party Chief Ron Rice
 _____ Notes _____
 _____ Witness Josh Reed

Surveyor's Seal

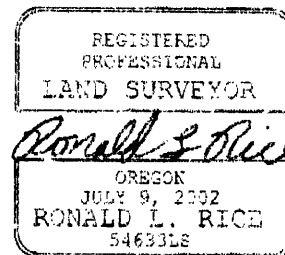

RENEWS: 12-31-2010

C.S. File No 65/69-41