

OREGON CORNER RESTORATION FORM

Section 36 Township 19 South, Range 9 West  
County Douglas Date 1 May 2012

FILED  
Date: 5/2/2012 By: JC  
This survey consists of:  
Map: \_\_\_\_\_  
Narrative: \_\_\_\_\_  
Corner Rpt: CS 65/76-54

DOUGLAS COUNTY  
SURVEYOR

Corner Description

E1/16 South Line  
Section 36

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed In
- Referenced Out

Previous Renewals / Surveys, etc.

5/8" Rebar set in C.S. File 55/259-2  
Tagged 26" Maple bears N 40° W 10.3' ft.

Monument (s) & Accessories Found: (Condition and Source)

Found – 5/8" Rebar set in C.S. File 55/259-2  
Tagged 26" Maple from C.S. File 55/259-2 - not found.  
1977 BLM tagged 64" D. Fir bears N 31-1/4° W 43.8 ft. – no marks.  
1977 BLM tagged 19" Maple bears N 66° W 19.4 ft. – no marks.

Monument Detail

Sketch

Monument Set (Procedures and Description)

None

New Accessories


1977 BLM tagged 64" D. Fir bears N 31-1/4° W 43.8 ft. blazed, scribed E1/16 S36 BT and retagged by Northwest Land Survey on this visit.

1977 BLM tagged 19" Maple bears N 66° W 19.4 ft. blazed, scribed E1/16 S36 BT by Northwest Land Survey on this visit.

Location & Comments

Corner has steel post \_\_\_\_\_ Compass Declination 16° East  
 adjacent to it. \_\_\_\_\_ Firm/Agency Northwest Land  
All BT's have red painted \_\_\_\_\_ Surveying Inc.  
bands and yellow tags. \_\_\_\_\_ Address P.O. Box 2827  
 \_\_\_\_\_ Florence, OR 97439  
 \_\_\_\_\_ Party Chief Ron Rice  
 \_\_\_\_\_ Notes \_\_\_\_\_  
 \_\_\_\_\_ Witness Jason Collver

Surveyor's Seal

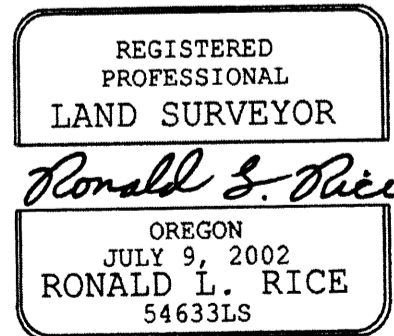

RENEWS: 12-31-2012

C.S. File No 65/76-54