

FILED

Date: 7/9/2019 By: JC

This survey consists of:

Map: \_\_\_\_\_

Narrative: \_\_\_\_\_

Corner Rpt: CS 65/102-61

**OREGON CORNER RESTORATION FORM**

SECTION 4 & 9

TOWNSHIP 22S RANGE 11W, WM

DOUGLAS COUNTY  
SURVEYOR

**Corner Designation**


W1/16 CORNER SECTIONS 4 & 9

**Previous Renewals / Surveys, etc.:**

M44-34 AND 74-65

- Condition Report Only
- Not Found
- Renewed
- Unrecorded
- Surveyed in
- Referenced Out

**Monument Detail Sketch**

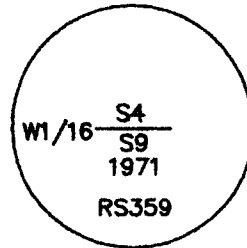

**Monument Found or Set (Procedures and Description)**

**FOUND MONUMENT:**

A 1 1/2" IRON PIPE WITH 3" BRASS CAP MARKED "W1/16 S4 S9 1971 RS359"  
SET IN CONCRETE IN BED ROCK DRAW. PER M44-34.

**FOUND BO:**

A ROCK POINT WITH NO VISIBLE MARKS BEARS S47°45'W 11.5'.

**New Accessories**

**NEW BT'S MARKED:**

A 16" ALDER, BARK SCRIBED "W1/16 S4 BT" WITH X-CHOP AND TAG BEARS  
N18°E 35.4' TO A SPIKE AT SIDE CENTER.

A 15" ALDER, BARK SCRIBED "W1/16 S4 BT" WITH X-CHOP AND TAG BEARS  
N70°W 15.5' TO A SPIKE AT SIDE CENTER.

**Locations & Comments**

LAT. AND LONG. PER GARMIN ETREX HAND HELD GPS  
N: 43°40'41.4" W: 124°01'28.7"

DATE 5/24/19

Compass Declination used on hand compass 18° EAST

Firm / Agency: Estabrook Land Surveying Inc.

Address: PO BOX 574, Lakeside, OR 97449

Party Chief: Pat Coy

Notes:

Witness: John Rondeau and Ray Banks

**Surveyors Seal**

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

OREGON  
JUNE 30, 1985  
JERRY LEE ESTABROOK  
2703

EXPIRES 12/31/19