

GOVERNMENT CORNER RESTORATION FORM

FILED

TOWNSHIP 30S RANGE 05W SEC. 22 PLSS # 047040

Date: 3-27-2013 By: JC

This survey consists of:

DOUGLAS COUNTY OREGON

DATE FEB. 13, 2013

Map: _____

Narrative: _____

Corner Rpt: CS 67/38-19

Corner Designation

DOUGLAS COUNTY SURVEYOR

SE
DLC 47

- ___ Condition Report
- ___ Not Found
- Renewed
- ___ Unrecorded
- ___ Surveyed In
- ___ Referenced Out

Previous Renewals 1920, 1963
Monument(s) Found: (Condition and Source)

MONUMENT DETAIL

FROM THE 1970 RENEWAL, A STONE MEASURING 5 X 3 INCHES PROTRUDES 2 INCHES ABOVE GROUND. STONE SHOWS NO MARKS.

COUNTY SURVEYORS OFFICE

T 30 S

FROM THE 1963 RENEWAL A 2 1/2 INCH DIAMETER BRASS CAP (MARKED AS AT RIGHT) ON A 1 INCH I.D. IRON PIPE IS FIRMLY AND PLUMBLY SET, PROTRUDING 18 INCHES ABOVE GROUND, ON THE EAST EDGE OF THE ABOVE FOUND STONE.

SE
DLC
47

R5W

1963

Accessories Found

ACCESSORIES ARE MEASURED FROM FOUND B.C. MONUMENT.

POSSIBLE EVIDENCE OF THE O.B.T.

A B. OAK 8" DIA. NOW A 26 INCH DIAMETER BLACK OAK WITH THE CENTER 20+ INCHES ROTTED AWAY (NO BLAZE OR SCRIBING EVIDENCE FOUND); BEARS N 22 1/2° W, 44 3 FEET DISTANT (RECORD N 20° W, 44 3 FEET).

TWO 1920 BEARING TREES

A LAUREL 8" DIA. NOW A 29 INCH DIAMETER MADRONE WITH A FULLY HEALED DOUBLE BLAZE; BEARS S 81° W, 15 8 FEET DISTANT (AS PER RECORD).

A W. OAK 22" DIA. NOW A 25 INCH DIAMETER WHITE OAK WITH AN EXPOSED DOUBLE BLAZE WITH FACES ROTTED AWAY; BEARS SOUTH, 7 2 FEET DISTANT (AS PER RECORD).

RENEWAL

Monument Set (Procedure and Description)

MONUMENT DETAIL

N/A

FOUND BC/IP MONUMENT POSITION IS REFERENCED OUT AND MONUMENT IS REMOVED FROM GROUND. MONUMENT IS REPLACED AT REFERENCED POSITION AND NOW PROTRUDES 7 INCHES ABOVE GROUND ON EAST EDGE OF FOUND STONE.



New Accessories

A 9 INCH DIAMETER DOUGLAS FIR SCRIBED "SE DLG 47 CS" "BT" ON A DOUBLE BLAZE; BEARS N 27 1/2° E, 16 3/4 FEET DISTANT.

A 6 INCH DIAMETER INCENSE CEDAR SCRIBED "X" "CS BT" ON A HIGH-LOW BLAZE; BEARS N 48 1/2° W, 7 1/2 FEET DISTANT.

Sketch of Monument, Accessories, and General Area

Location & Comments

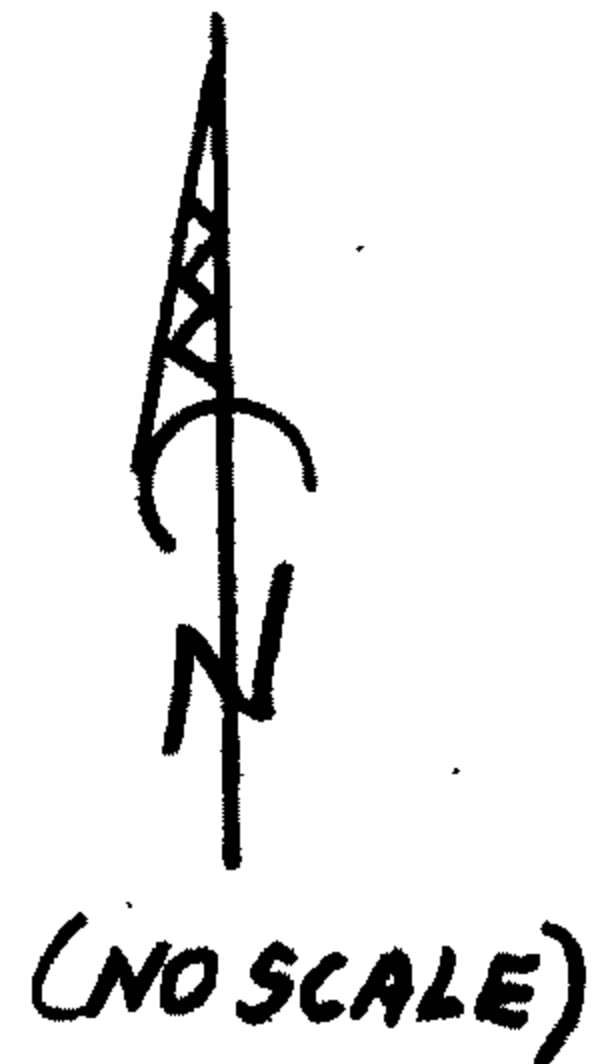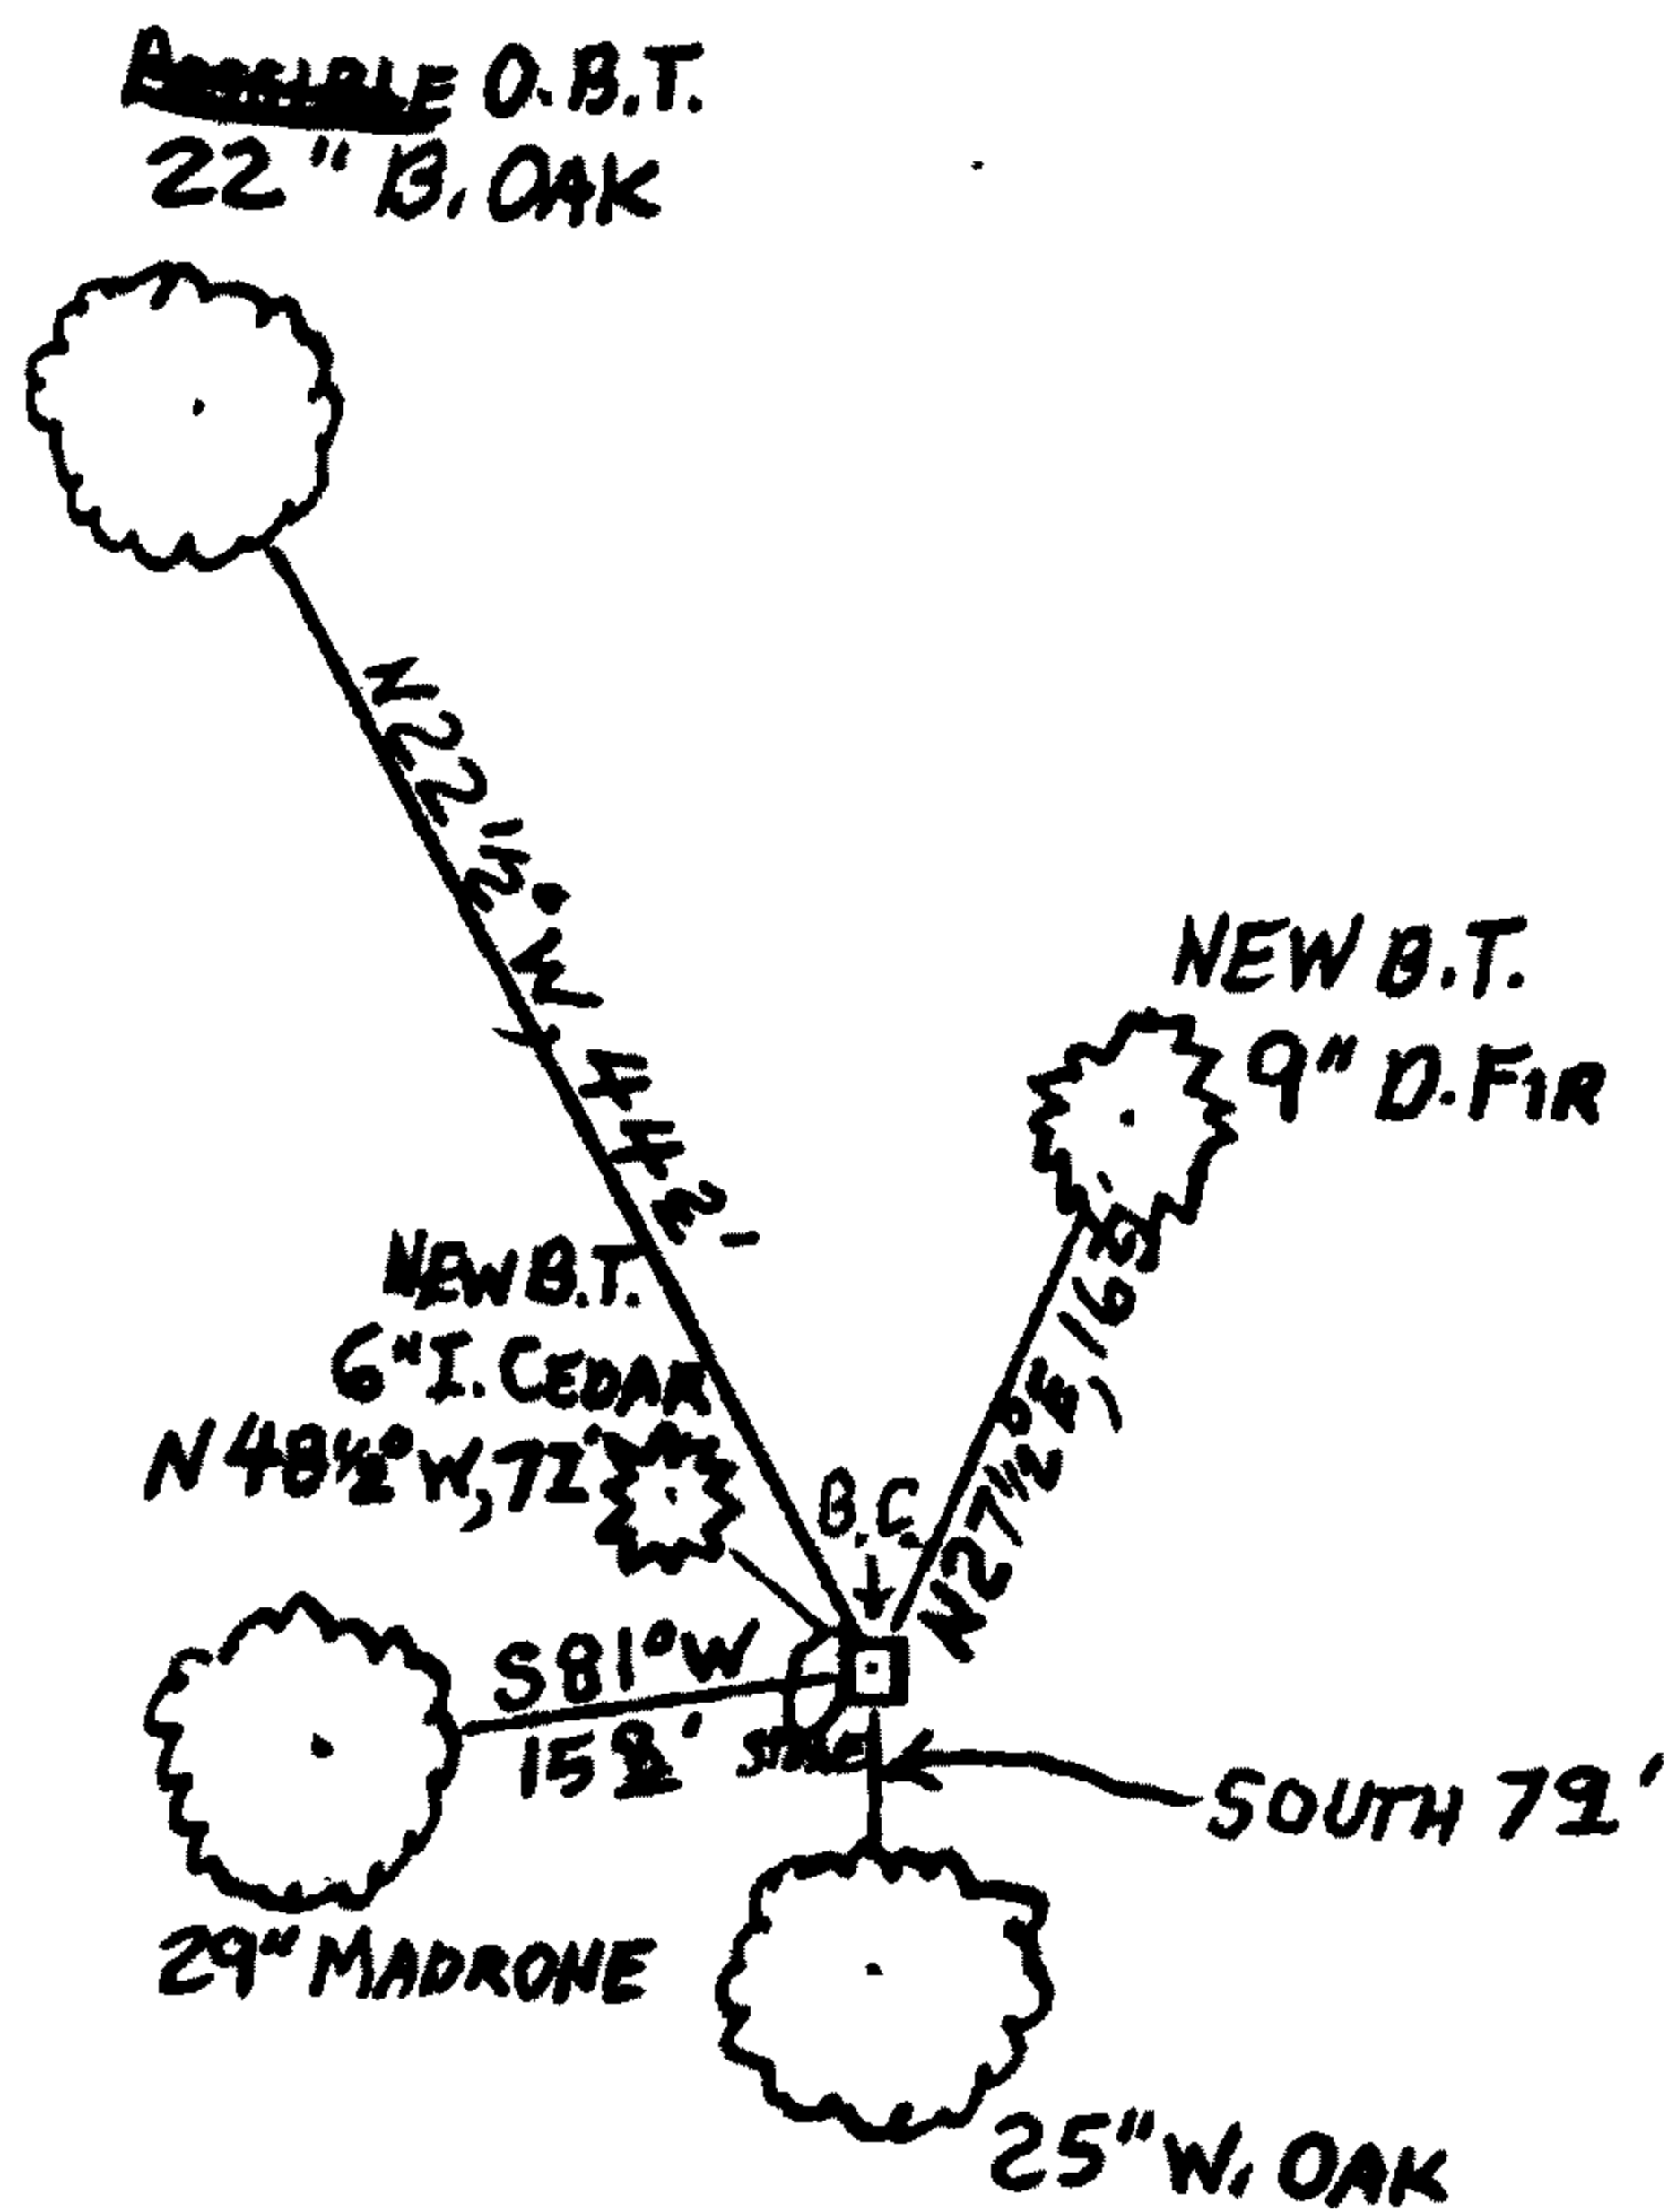

MONUMENT IS ON MODERATE EAST SLOPE IN MIXED OPEN WOODS OF FIR, CEDAR, OAK AND MADRONE.

Comp. Decline. 15 1/2° E
Agency DCSO
Party Chief STEPHEN JOHN FLAUSE
Note keeper Stephen John Flause
Witnesses MIKE S. KOCH

Surveyor's Seal

REGISTERED PROFESSIONAL LAND SURVEYOR

Renewed with
2014 6-30-2014

OREGON
JULY 25, 1990
RANDALL W. SMITH
2400