

GOVERNMENT CORNER RESTORATION FORM

FILED

TOWNSHIP 26S RANGE 2W SEC. 26 PLSS # 540220

Date: 2/14/2023 By: XC

This survey consists of:

Map: \_\_\_\_\_

Narrative: \_\_\_\_\_

Corner Rpt: CS 67/55-24

DOUGLAS COUNTY OREGON

DATE 1-13-23

DOUGLAS COUNTY  
SURVEYOR

Corner Designation

CS 1/16 526

Monument(s) Found: (Condition and Source)

\_\_\_ Condition report

\_\_\_ Not Found

Renewed

\_\_\_ Unrecorded

\_\_\_ Surveyed In

3'14" BLM BRASS CAP PROJ

3" IN MOUND OF STONE

Previous Renewals

Set By BLM IN 2011

MONUMENT DETAIL

C  
5'1/16 | 526  
C  
2011

Accessories Found

BURNED DEAD 13" CEDAR 53 1/2° E 24.5 FT (REC  
24.2 FT) FACE PARTLY HEALED W/IS SCRIBES  
ADD 3 1/2" MAG NAIL RIGHT SIDE CENTER

15" X 6 FT BURNED FIR STUB 56 20° W 48.2 FT  
(REC 48.9) WITH METAL RAIN CAP 3 1/2"  
MAG NAIL RIGHT SIDE CENTER

C.S. File 67/55-24

13

Monument Set (Procedure and Description)

MONUMENT DETAIL

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

New Accessories

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

Sketch of Monument, Accessories, and General Area

Location & Comments

Lat 43°16'19.01"N  
Long 122°54'12.86"W

AREA BURD  
9-2020

CORNER IS 55 FT N. OF A  
GRAVEL ROAD 18' WIDE BEARS  
N80°E & S80°W ALSO LOCATED  
375' E. OF SAME GRAVEL  
ROAD 12' WIDE BEARS N60W  
& S60E

Comp. Decline. 14 1/2° E  
Agency DCSO  
Party Chief S. FRAUSE  
Note keeper \_\_\_\_\_  
Witnesses J. LORSUNY

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Ronald A. Quimby*

OREGON  
JULY 14, 1978  
RONALD A. QUIMBY  
1654

EXPIRES: 12/31/2024

CS 67/55-24

MM GPS 1/27/22  
TIME - 9:20  
H.L. - 2.000 M

RENEWED 01/13/23  
T26S, R02W, 540220

22937

Subdivision of Section 26  
T. 26 S., R. 2 W., Willamette Meridian, Oregon

The 1/4 sec. cor. of sec. 26 only, monumented with an iron post, 1 in. diam., firmly set, projecting 7 ins. above ground, with brass cap mkd.

1/4 S 26  
1916

from which an original bearing tree

A cedar, 62 ins. diam., bears N. 42° W., 15.2 ft. dist., with a healed blaze.


and bearing trees mkd. by the Douglas County Surveyor's Office in 1967

A cedar, 34 ins. diam., bears N. 54 1/2° E., 42.9 ft. dist., with a healed blaze.  
(Record, N. 52° E.)

A cedar, 32 ins. diam., bears N. 55° W., 38.3 ft. dist., with a healed blaze.

Point for the center S 1/16 sec. cor. of sec. 26.

Set a stainless steel post, 28 ins. long, 2 1/2 ins. diam., 7 ins. in the ground to underlying rock, in a mound of stone, 3 ft. base, to top, with brass cap mkd. - 3 1/4" DIAM

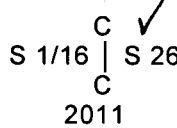

NOW PROTRUDES 3" FROM  
30" DIAM. X 18" TALL MOUND  
OF STONE.

from which

*BURNED DEAD 13"* - A cedar, 10-ins. diam., bears S. 31 1/2° E., <sup>245</sup>24.2 ft. dist., mkd. ~~CS 1/16 S 26 B1~~ *BOTH BST'S NOW HAVE 3 1/2" MAG NAIL R.S.C.*

*NOW BURNED OFF FIR STUD* fir, 21 ins. diam., bears S. 62° W., <sup>482</sup>48.9 ft. dist., mkd. ~~CS 1/16 S 26 BT~~ *FACE PART. HEALED, BURNED, PART. SCRIBING*

*HAS METAL RAIN CAP* Corner is located 55 ft. N. of a gravel road, 18 ft. wide, bears N. 80° E. and S. 80° W., and further located 375 ft. E. of the same gravel road, 12 ft. wide, bears N. 60° W. and S. 60° E. *FACE BURNED SOME PARTIAL SCRIBING REMAINS.*