

RECOVERED MONUMENT LIST (SEE SHTS. 1 & 2 FOR NETWORK & STRATEGIC PTS.)

PT. NO.	LDP NORTHING	LDP EASTING	STATION	OFFSET	DATE	DESCRIPTION & REFERENCE DOCUMENTS
1015	170744.958	376672.421	83+646.787	37.998	2-07-02	FND. 1/2" IRON ROD 50 mm ABOVE SURFACE, WITNESS POST NEARBY MARKED "SHRW 2744+32.00 125", GOOD CONDITION
2002	170717.486	376667.228	N/A	N/A	2-07-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "OREGON STATE HIGHWAY DIV", 50 mm ABOVE SURFACE, GOOD CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *M98-58)
2003	170701.247	376641.475	N/A	N/A	2-07-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "OREGON STATE HIGHWAY DIV", 130 mm BELOW SURFACE, GOOD CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *M98-58)
2004	170708.247	376627.756	N/A	N/A	2-07-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "OREGON STATE HIGHWAY DIV", FLUSH W/SURFACE, GOOD CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *M98-58)
2005	170741.181	376625.009	N/A	N/A	2-07-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "AA SURVEY" FLUSH W/SURFACE, GOOD CONDITION (REF. SURVEY M109-61)
2006	170705.051	376605.838	N/A	N/A	2-07-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "AA SURVEY" 100 mm BELOW SURFACE, GOOD CONDITION (REF. SURVEY M109-61)
2007	170733.294	376553.578	N/A	N/A	2-07-02	FND. 7/8" BOLT WITH A NUT, 70 mm BELOW SURFACE, POOR CONDITION. BENT TO THE S.W.; TIED WHERE BOLT ENTERS GROUND.
2008	170743.853	376540.372	N/A	N/A	2-07-02	FND. 7/8" IRON ROD 150 mm ABOVE SURFACE, GOOD CONDITION
2009	170653.209	376602.966	N/A	N/A	2-07-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "OREGON STATE HIGHWAY DIV" 55 mm ABOVE SURFACE, GOOD CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *98-58)
2010	170610.531	376587.584	N/A	N/A	2-07-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "OREGON STATE HIGHWAY DIV" FLUSH W/SURFACE, GOOD CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *M98-58)
2011	170538.893	376562.976	N/A	N/A	2-07-02	FND. 5/8" IRON ROD 40 mm ABOVE SURFACE, GOOD CONDITION (REF. SURVEY M98-58)
2023	170713.071	376684.131	83+680.960	37.862	2-11-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "OREGON STATE HIGHWAY DIV." 170 mm ABOVE SURFACE, FAIR CONDITION, WITNESS POST NEARBY MARKED "SHRW"
2024	170649.502	376705.531	83+749.712	37.951	2-11-02	FND. 5/8" IRON ROD 120 mm BELOW SURFACE, GOOD CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *98-58)
2038	170678.883	376995.625	N/A	N/A	2-12-02	FND. 1" IRON ROD BENT TO THE NORTHWEST, POOR CONDITION, TIED WHERE ROD ENTERS GROUND (REF. MCNARY SUBD., VOL. 7, PG. 5)
2039	170693.774	376982.595	N/A	N/A	2-12-02	FND. 1" O.D. IRON PIPE 390 mm ABOVE SURFACE, GOOD CONDITION (REF. SURVEY *M106-26)
2040	170854.457	376840.986	42+681.900	45.367	2-12-02	FND. 5/8" IRON ROD 90 mm BELOW SURFACE, BENT TO THE NORTH, FAIR CONDITION, TIED TOP OF ROD (REF. ODOT DRG. NO. 7B-23-1)
2041	170854.451	376840.755	42+681.162	45.162	2-12-02	FND. 5/8" IRON REBAR BENT TO NORTH, VERY POOR CONDITION, TIED WHERE ROD ENTERS GROUND (REF. ODOT DRG. NO. 7B-23-1)
2025	170429.935	376632.477	42+207.238	-15.240	2-11-02	FND. SIX SIDED PIPE 3/4" O.D. 30 mm BELOW SURFACE, GOOD CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *M19-79)
2026	170424.589	376611.807	N/A	N/A	2-11-02	FND. 1 1/2" O.D. PIPE 130 mm BELOW SURFACE, FAIR CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *M19-79)
2027	170447.274	376544.340	N/A	N/A	2-11-02	FND. 5/8" IRON ROD 240 mm BELOW SURFACE, GOOD CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *M35-30)
2028	170451.247	376532.789	N/A	N/A	2-11-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "OREGON STATE HIGHWAY DIV", 20 mm BELOW SURFACE, GOOD CONDITION, WITNESS POST NEARBY MARKED "SHRW" (REF. SURVEY *M98-58)
2029	170369.339	376613.056	42+143.606	-15.332	2-11-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "AA SURVEYING", 30 mm BELOW SURFACE, GOOD CONDITON (REF. SURVEY *M106-73)
2030	170283.331	376582.654	42+052.427	-18.166	2-11-02	FND. 5/8" IRON ROD 20 mm ABOVE SURFACE, GOOD CONDITION (REF. SURVEY *M99-57)
2031	170283.239	376585.711	42+053.268	-15.225	2-11-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "AA SURVEYING INC", 110 mm BELOW SURFACE, GOOD CONDITION (REF. SURVEY *M99-57)
2032	170311.358	376594.663	42+082.778	-15.240	2-11-02	FND. 5/8" IRON ROD W/1 1/4" PLASTIC CAP STAMPED "AA SURVEYING", 100 mm BELOW SURFACE, GOOD CONDITION (REF. SURVEY *106-73)
2033	170532.166	376837.274	N/A	N/A	2-11-02	FND. 5/8" IRON ROD 160 mm ABOVE SURFACE, BENT OVER, POOR CONDITION, TIED WHERE ROD ENTERS GROUND
2034	170278.766	376742.807	84+135.934	38.343	2-11-02	FND. 5/8" IRON ROD 350 mm ABOVE SURFACE, BENT TO THE S.E., POOR CONDITION, TIED WHERE ROD ENTERS GROUND
2035	170137.318	376818.018	84+276.850	-37.860	2-12-02	FND. 5/8" IRON ROD 190 mm ABOVE SURFACE, BENT WEST, POOR CONDITION, TIED WHERE ROD ENTERS GROUND
2036	170278.050	376819.165	84+136.113	-38.018	2-12-02	FND. 5/8" IRON ROD 140 mm ABOVE SURFACE, GOOD CONDITION
2037	170277.574	376834.113	84+136.484	-52.969	2-12-02	FND. 5/8" IRON ROD 210 mm ABOVE SURFACE, GOOD CONDITION

REFER TO SHEET 5

REFER TO SHEET 6

TO CONVERT METERS TO FEET DIVIDE BY 0.30480061

FILED  
Date: 4-24-2002 By: JC  
This survey consists of:  
Map: St Hwy 15 - 014 A-H  
Narrative:  
Corner Rpt: \_\_\_\_\_


DOUGLAS COUNTY  
SURVEYOR

REGISTERED  
PROFESSIONAL  
LAND SURVEYOR

*Christine V. Blevins*

OREGON  
JULY 19, 1994  
CHRISTINE V. BLEVINS  
2669

EXPIRES 12/31/03

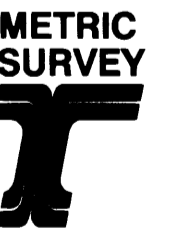

OREGON DEPARTMENT OF TRANSPORTATION  
HORIZONTAL CONTROL, RECOVERY AND RETRACEMENT MAP  
SHADY BRIDGE  
PACIFIC HWY. (INTERSTATE 5)  
DOUGLAS COUNTY

APRIL 15, 2002 FOR ODOT REGION 3  
3500 NW STEWART PARKWAY, ROSEBURG, OR 97470

SCALE: 1 mm = 1 m

SHEET 7 OF 8

ST. HWY. 15- 014G