NE1/4 SEC. 11 & NW1/4 SEC. 12, T. 28 S., R. 6 W., W.M.

FILED
Date: 1-28-19 By: BJ
This survey consist of:
Map: ST. HWY I5-031 A-K
Narrative:
Corner Rpt:
DOUGLAS COUNTY SURVEYOR

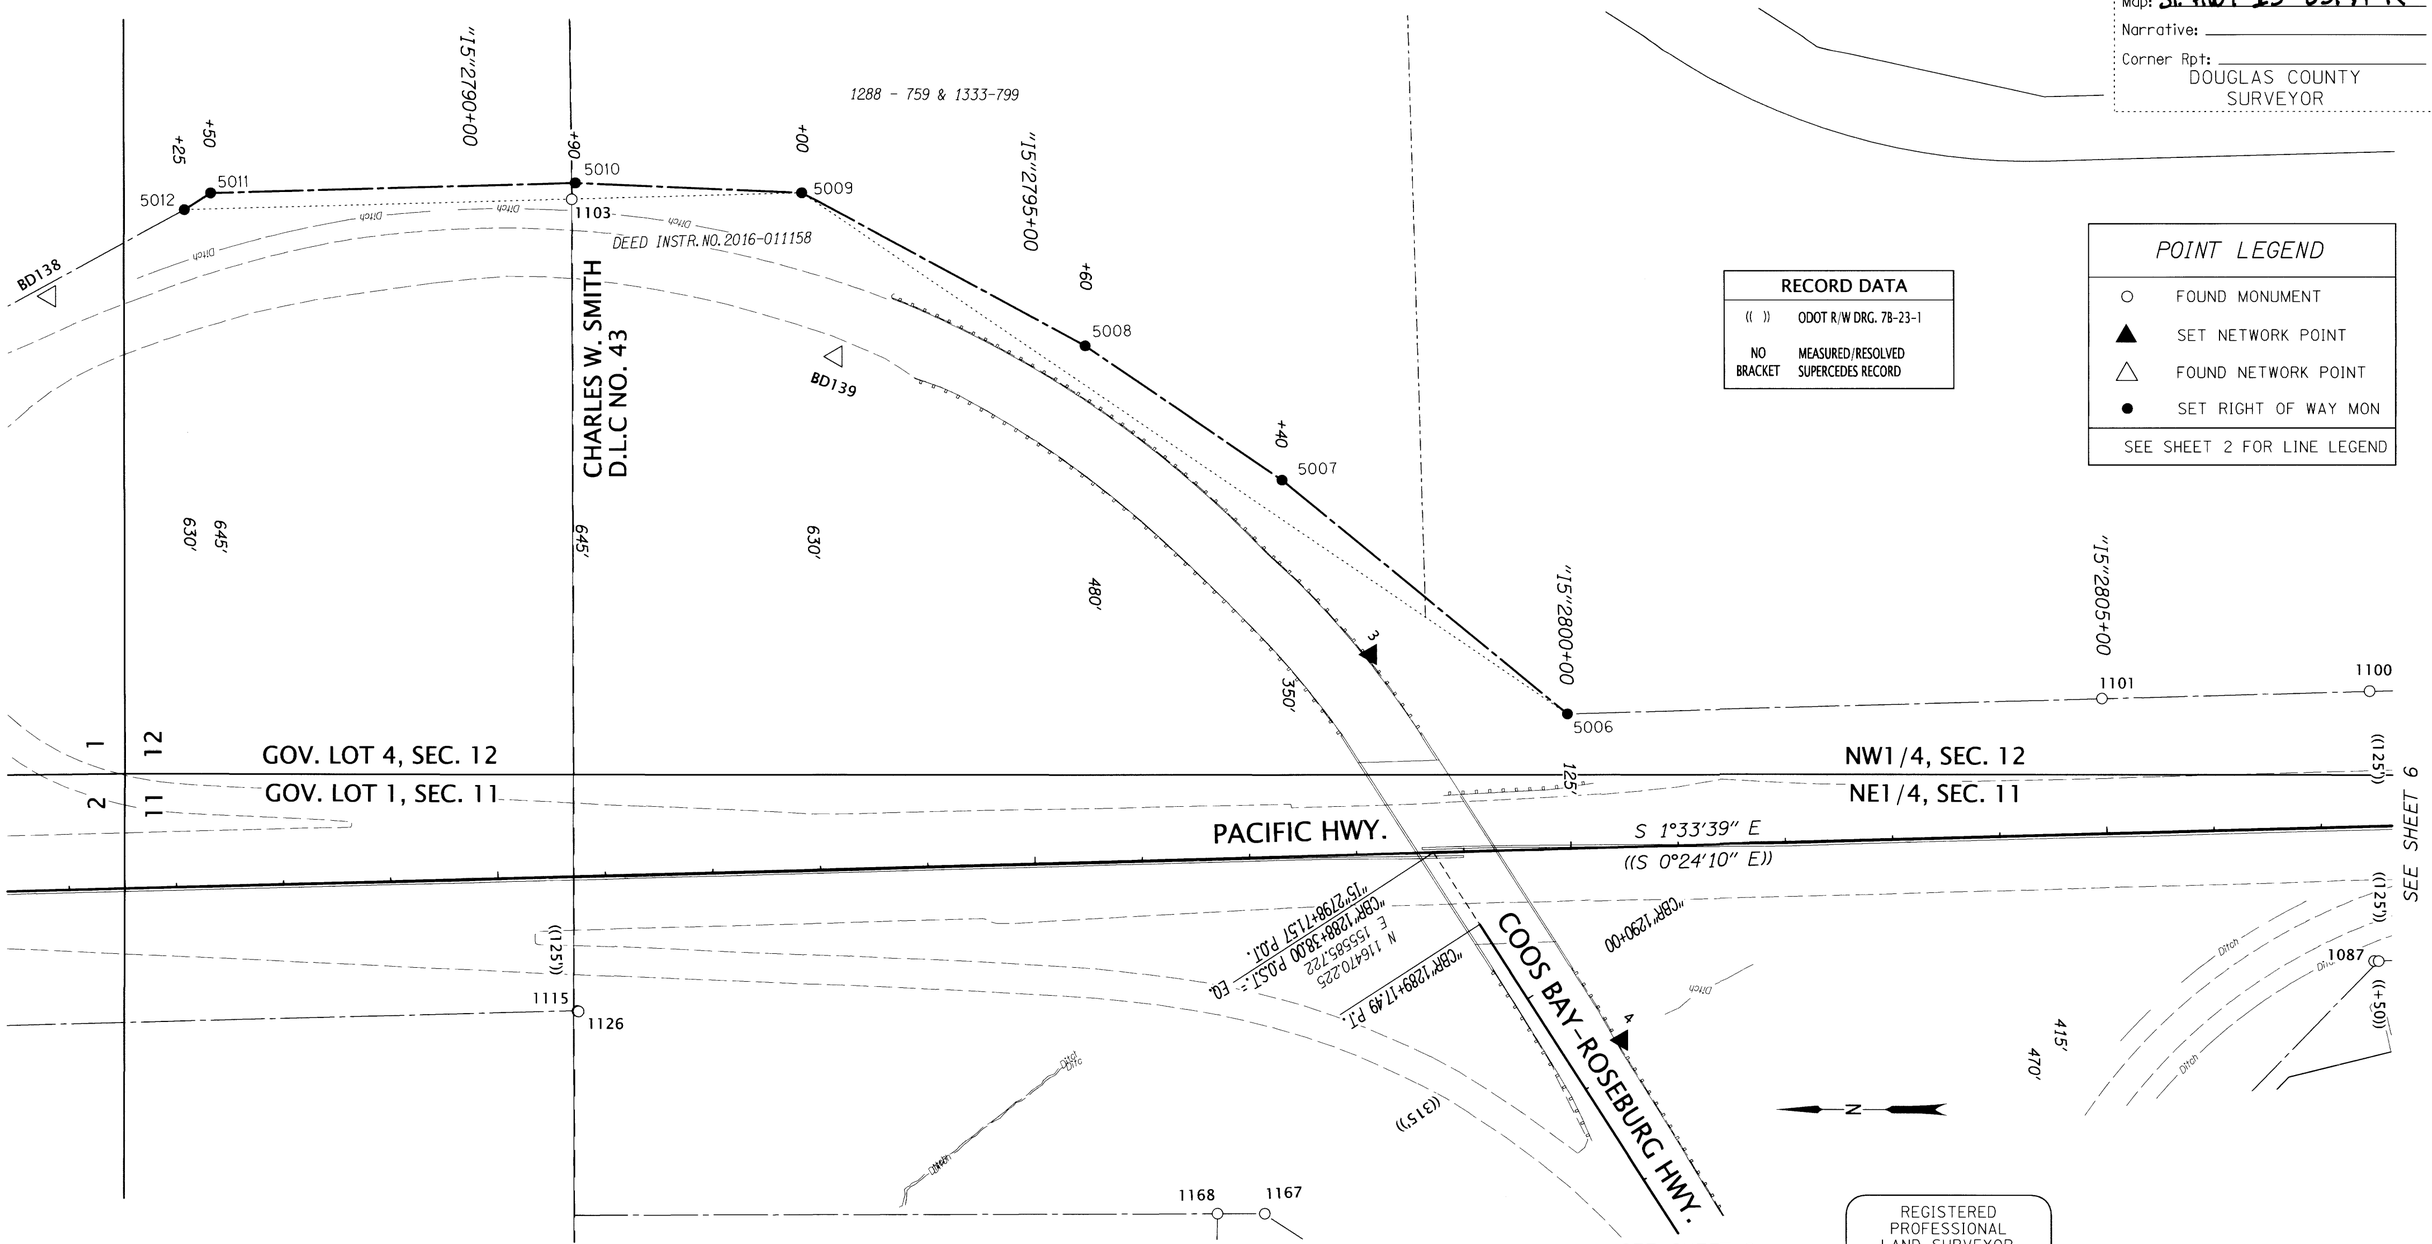

REGISTERED PROFESSIONAL LAND SURVEYOR
Marshall R. Wagstaff
OREGON
JANUARY 9, 2001
MARSHALL R. WAGSTAFF
49476LS
RENEWS: JUNE 30, 2020

MONUMENTS

FD. = FOUND ALUM. = ALUMINUM OPC = ORANGE PLASTIC CAP YPC = YELLOW PLASTIC CAP

PT. NO.	OCRS NORTHING	OCRS EASTING	ELEVATION	STATION	OFFSET (- IS LEFT)	DATE	DESCRIPTION	REFERENCE
3	116528.675	155769.657	563.27	"I5"2798+18.15	-185.46	8/23/2012	SET 5/8' x 30" IRON REBAR WITH 1 1/2' BRASS CAP STAMPED "ODOT CONTROL 3"	-
4	116294.514	155411.255	554.85	"I5"2800+42.46	179.19	8/23/2012	SET 5/8' x 30" IRON REBAR WITH 1 1/2' BRASS CAP STAMPED "ODOT CONTROL 4"	-
1087	115592.984	155484.460	-	"I5"2807+45.73	125.12	7/30/2012	FD. 5/8" SMOOTH IRON ROD BENT N.W. TIED WHERE ROD ENTERS GROUND. FLUSH WITH GROUND.	NO RECORD
1100	115597.006	155734.722	-	"I5"2807+48.52	-125.16	7/30/2012	FD. 5/8" SMOOTH IRON ROD 0.1 FT ABOVE CONCRETE FOR FENCE POST, LEANS EAST FAIR CONDITION, WOBBLELY 4"X4" WOOD WITNESS POST NEARB Y. STATION 2807+50 125 LT.	7B-23-1
1101	115846.788	155727.860	-	"I5"2804+98.64	-125.11	7/30/2012	FD. 5/8" SMOOTH IRON ROD 0.4 FT. ABOVE GROUND GOOD CONDITION 4"X4" WOOD WITNESS POST NEARBY MARKED "SHRW" STATION 2805+00 125 LT.	7B-23-1
1103	117272.519	156193.883	-	"I5"2790+86.14	-629.79	7/31/2012	FD. 5/8" IRON ROD REBAR 0.25 FT ABOVE GROUND GOOD CONDITION ON DLC LINE.	ST. HWY. 42-011
1115	117267.612	155438.453	-	"I5"2790+70.47	125.50	7/31/2012	FD. 5/8" SMOOTH IRON ROD FLUSH WITH GROUND, GOOD CONDITION	M56-66
1126	117266.544	155438.139	-	"I5"2790+71.52	125.84	7/31/2012	FD. 5/8" IRON ROD WITH 1 1/2" ALUM. CAP STAMPED "SHANER ENGINEERING" 0.1 FT. ABOVE GROUND FAIR CONDITION	M56-66
1167	116627.461	155250.336	-	"CBR"1290+34.65	313.90	1/6/2017	FD. IRON ROD WITH 1 1/4" YPC STAMPED "LANDMARK PLS 2287" 0.2 FT. ABOVE GROUND, GOOD CONDITION	M171-3
1168	116671.521	155250.380	-	"I5"2796+61.21	329.74	1/6/2017	FD. IRON ROD WITH 1 1/4" YPC STAMPED "LANDMARK PLS 2287" 0.1 FT. ABOVE GROUND, GOOD CONDITION	M171-3
5006	116345.245	155714.173	-	"I5"2800+00.00	-125.00	8/20/2018	SET 5/8 X 30" IRON REBAR WITH 2" ALUM. CAP STAMPED "ODOT RIGHT OF WAY 5006"	-
5007	116611.276	155932.009	-	"I5"2797+40.00	-350.00	8/20/2018	SET 5/8 X 30" IRON REBAR WITH 2" ALUM. CAP STAMPED "ODOT RIGHT OF WAY 5007"	-
5008	116794.750	156057.058	-	"I5"2795+60.00	-480.00	8/20/2018	SET 5/8 X 30" IRON REBAR WITH 2" ALUM. CAP STAMPED "ODOT RIGHT OF WAY 5008"	-
5009	117058.739	156199.921	-	"I5"2793+00.00	-630.00	8/20/2018	SET 5/8 X 30" IRON REBAR WITH 2" ALUM. CAP STAMPED "ODOT RIGHT OF WAY 5009"	-
5010	117269.070	156209.196	-	"I5"2790+90.00	-645.00	8/20/2018	SET 5/8 X 30" IRON REBAR WITH 2" ALUM. CAP STAMPED "ODOT RIGHT OF WAY 5010"	-
5011	117608.944	156199.936	-	"I5"2787+50.00	-645.00	8/20/2018	SET 5/8 X 30" IRON REBAR WITH 2" ALUM. CAP STAMPED "ODOT RIGHT OF WAY 5011"	-
5012	117633.526	156184.260	-	"I5"2787+25.00	-630.00	8/20/2018	SET 5/8 X 30" IRON REBAR WITH 2" ALUM. CAP STAMPED "ODOT RIGHT OF WAY 5012"	-
BD139	117027.181	156047.373	556.39	"I5"2793+27.39	-476.65	8/27/2012	FD. 1 1/4" ORANGE PLASTIC CAP STAMPED "BLUE DOT CONTROL" 0.1 FT BELOW GROUND GOOD CONDITION.	ST. HWY. 42-011

OREGON DEPARTMENT OF TRANSPORTATION

HORIZONTAL CONTROL, RECOVERY, RETRACEMENT & BOUNDARY MONUMENTATION MAP
I-5: EXIT 119 & 120 INTERCHANGE IMPROVEMENTS
PACIFIC HWY./COOS BAY - ROSEBURG HWY./OLD HWY. 99
DOUGLAS COUNTY
FILE: 17918RW.DGN :: CRR

ODOT REGION 3 TECH CENTER
3500 NW. STEWART PKWY.
ROSEBURG, OR. 97470

JANUARY 10, 2019
SCALE: 1" = 100'
SHEET 5 OF 11

ST. HWY. I5-031 E